

This anomaly list describes the known bugs, anomalies, and workarounds for the [ADIS16209](#).

Analog Devices, Inc., is committed, through future silicon revisions, to continuously improve silicon functionality. Analog Devices tries to ensure that these future silicon revisions remain compatible with your present software/systems by implementing the recommended workarounds outlined within this document.

## PERFORMANCE ISSUES

**Table 1. Anomalous Start-up Behavior [er001]**

<b>Background</b>	The <a href="#">ADIS16209</a> uses a number of internal functions (accelerometer, A/D, D/A, I/O, clock, reference) to produce highly accurate tilt angles, with respect to gravity. Once the power supply level reaches +2.35 V, the <a href="#">ADIS16209</a> begins its power-on sequence to start each of these functions. The <a href="#">ADIS16209</a> uses an internal processor core and firmware to facilitate this power-on sequence.
<b>Issue</b>	On a small percentage of units that have Date Code 1233 (or lower), the start-up process occasionally exhibits behaviors that preclude correct inclinometer function and supply measurements. The observable symptoms include (but are not limited to) the following: <ul style="list-style-type: none"> <li>SUPPLY_OUT &lt; 1 V (when VCC = +3.0 V to 3.3 V)</li> <li>STATUS[0] = 1, indicating the low-supply error condition</li> <li>Incorrect XINCL_OUT, YINCL_OUT measurements</li> </ul>
<b>Workaround</b>	Investigation of this phenomenon has found that the anomalous start-up behavior depends on external power supply configurations and the source impedance they present to the <a href="#">ADIS16209</a> . When experiencing these behaviors, review the application design for opportunities to lower the source impedance of the power supply (situational improvements in power trace routing and/or bypass have eliminated this behavior). Units that have a Date Code of 1234 (or higher) use firmware revision 1.5, which modifies the power-up sequence in a manner that improves its noise immunity during start-up. For units that have a Date Code of 1233 (or lower), all current inventory was updated to firmware revision 1.5, while shipments that came before this update have a firmware revision 1.4, which does not incorporate this modified power-on sequence.  Note that the firmware revision resides in an undocumented register location, at Address 0x46 and uses an 8-bit, 2-digit binary digital code (BCD) format. Reading Address 0x46 returns a 16-bit number, which represents address locations 0x46 and 0x47. Mask off the upper 8-bits to eliminate the contents from Address 0x47 and use the remaining 8-bits to determine the firmware revision on an <a href="#">ADIS16209</a> . The lower nibble represents the tenths digit and the upper nibble represents the ones digit. For example, 0x14 would represent firmware revision 1.4, which indicates that the unit does not employ the updated power-on sequence. If this location contains the hexadecimal number of 0x15, then the unit uses firmware revision 1.5, which employs the modified power-on sequence.
<b>Related Issues</b>	None.

## ANOMALY STATUS

Reference Number	Description	Status	Date Code
er001	Anomalous Start-up Behavior	Fixed	1234

### Rev. 0

Information furnished by Analog Devices is believed to be accurate and reliable. However, no responsibility is assumed by Analog Devices for its use, nor for any infringements of patents or other rights of third parties that may result from its use. Specifications subject to change without notice. No license is granted by implication or otherwise under any patent or patent rights of Analog Devices. Trademarks and registered trademarks are the property of their respective owners.

**NOTES**



Компания «ЭлектроПласт» предлагает заключение долгосрочных отношений при поставках импортных электронных компонентов на взаимовыгодных условиях!

Наши преимущества:

- Оперативные поставки широкого спектра электронных компонентов отечественного и импортного производства напрямую от производителей и с крупнейших мировых складов;
- Поставка более 17-ти миллионов наименований электронных компонентов;
- Поставка сложных, дефицитных, либо снятых с производства позиций;
- Оперативные сроки поставки под заказ (от 5 рабочих дней);
- Экспресс доставка в любую точку России;
- Техническая поддержка проекта, помощь в подборе аналогов, поставка прототипов;
- Система менеджмента качества сертифицирована по Международному стандарту ISO 9001;
- Лицензия ФСБ на осуществление работ с использованием сведений, составляющих государственную тайну;
- Поставка специализированных компонентов (Xilinx, Altera, Analog Devices, Intersil, Interpoint, Microsemi, Aeroflex, Peregrine, Syfer, Eurofarad, Texas Instrument, Miteq, Cobham, E2V, MA-COM, Hittite, Mini-Circuits, General Dynamics и др.);

Помимо этого, одним из направлений компании «ЭлектроПласт» является направление «Источники питания». Мы предлагаем Вам помощь Конструкторского отдела:

- Подбор оптимального решения, техническое обоснование при выборе компонента;
- Подбор аналогов;
- Консультации по применению компонента;
- Поставка образцов и прототипов;
- Техническая поддержка проекта;
- Защита от снятия компонента с производства.



#### Как с нами связаться

**Телефон:** 8 (812) 309 58 32 (многоканальный)

**Факс:** 8 (812) 320-02-42

**Электронная почта:** [org@eplast1.ru](mailto:org@eplast1.ru)

**Адрес:** 198099, г. Санкт-Петербург, ул. Калинина, дом 2, корпус 4, литера А.