

Active Errata List

- During UART Reception, Clearing REN May Generate Unexpected IT
- SPI Interface - Transmission on Master Mode
- SPI Interface - SPI SS pin Limitation on Master/Slave
- SPI - SPI Slave Responding in a Multislave Configuration When Not Selected by the Master and its SPDAT Register Loaded
- SPI - SPI Slave Not Responding When Selected and Not Loaded
- ALE Disabled Toggles During Internal MOVX
- Timer 2 - Baud Rate Generator - No IT When TF2 is Set by Software
- Timer 2 - Baud Rate Generator - Long Start Time
- SPI Slave Mode/Data Corrupted
- 32 kHz Oscillator for AT83C51IC2/T80C51ID2 Needs External Feed Back Resistor
- RB8 Lost With JBC on SCON
- C51 Core – Bad Exit of Power-down in X2 Mode

Errata History

Rev	Lot Number	1st Prod.	Trouble List
A	above 00395	Nov 2001	1, 2, 3, 4, 5, 6, 7, 8, 9, 10, 11

Errata Descriptions

1. During UART Reception, Clearing REN May Generate Unexpected IT

During UART reception, if the REN bit is cleared between a start bit detection and the end of reception, the UART will not discard the data (RI is set).

Workaround

Test REN at the beginning of Interrupt routine just after CLR RI, and run the Interrupt routine code only if REN is set.

2. SPI Interface - Transmission on Master Mode

A 9th bit is transmitted by the interface when the clock rate is set on divide by 2 mode and a positive polarity is selected; the SPR2, SPR1, SPR0 bits are cleared (000) and CPOL = 1 on the SPCON register.

Workaround

Set the clock rate divide by 4 and X2 mode.

3. SPI Interface - SPI SS pin Limitation on Master/Slave

The SS pin of the SPI does not return to an I/O when a One-to-One Master/Slave intercommunication is performed.

Workaround

No

4. SPI - SPI Slave Responding in a Multislave Configuration When Not Selected by the Master and its SPDAT Register Loaded

In a multislave configuration, if the master is sending the Sck and the Tx data to all the slaves, and only one slave is selected, the non-selected slaves respond and generate the end of the transmission interruption (SPIF) if their SPDAT registers are loaded before the transmission.

Workaround

No



80C51 MCUs

AT83C51RB2

AT83C51RC2

AT83C51IC2

AT80C51ID2

AT80C51RD2

Errata Sheet



5. SPI - SPI Slave Not Responding When Selected and Not Loaded

SPI Slave does not respond when selected by a Master and no Data is loaded to be transmitted. No Rx data is registered and no SPIF interruption is generated at the end of the Transmission.

Workaround

No

6. ALE Disabled Toggles During Internal MOVX

When ALE is disabled, internal MOVX instruction shows toggle of ALE.

Workaround

No

7. Timer 2 - Baud Rate Generator - No IT When TF2 is Set by Software

When timer 2 is used in baud rate generator mode, setting TF2 by software doesn't generate an interrupt.

Workaround

Use timer 1 instead of timer 2 to generate baud rate and interrupt.

8. Timer 2 - Baud Rate Generator - Long Start Time

When timer 2 is used as baud rate generator, TH2 is not loaded with RCAP2H at the beginning, then UART is not operational before 10000 machine cycles.

Workaround

Add the initialisation of TH2 and TL2 in the initialisation of timer 2.

9. SPI Slave Mode/Data Corrupted

When SPI macro is configured in slave reception mode, the SPI block does not handle the good data on the SPI bus.

Workaround

No

10. 32 kHz Oscillator for AT83C51IC2/T80C51ID2 Needs External Feed Back Resistor

Internal feed back resistor is not connected, thus to start up, the 32 kHz Oscillator an external resistor is required.

Workaround

Connect between XTALB1 and XTALB2 a 2 MΩ resistor

11. RB8 Lost With JBC on SCON

On C51 when using JBC instruction on any bit of SCON register, if RB8 bit changes from "1" to "0" during JBC the "0" is lost and RB8 keeps "1".

Workaround

The workaround is to clear RB8.

In a polling algorithm you must clear RB8 at the beginning of the code and after each time it goes to "1".

Interrupt RB8 must be cleared at the beginning of the code and after each time it goes to "1".

12. C51 Core – Bad Exit of Power-down in X2 Mode

When exiting power-down mode by interrupt while CPU is in X2 mode, it leads to bad execution of the first instruction run when CPU restarts.

Workaround

Set the CPU in X1 mode directly before entering power-down mode.



Headquarters

Atmel Corporation
2325 Orchard Parkway
San Jose, CA 95131
USA
Tel: 1(408) 441-0311
Fax: 1(408) 487-2600

International

Atmel Asia
Room 1219
Chinachem Golden Plaza
77 Mody Road Tsimshatsui
East Kowloon
Hong Kong
Tel: (852) 2721-9778
Fax: (852) 2722-1369

Atmel Europe
Le Krebs
8, Rue Jean-Pierre Timbaud
BP 309
78054 Saint-Quentin-en-
Yvelines Cedex
France
Tel: (33) 1-30-60-70-00
Fax: (33) 1-30-60-71-11

Atmel Japan
9F, Tonetsu Shinkawa Bldg.
1-24-8 Shinkawa
Chuo-ku, Tokyo 104-0033
Japan
Tel: (81) 3-3523-3551
Fax: (81) 3-3523-7581

Product Contact

Web Site
www.atmel.com

Technical Support
Enter Product Line E-mail

Sales Contact
www.atmel.com/contacts

Literature Requests
www.atmel.com/literature

Disclaimer: The information in this document is provided in connection with Atmel products. No license, express or implied, by estoppel or otherwise, to any intellectual property right is granted by this document or in connection with the sale of Atmel products. **EXCEPT AS SET FORTH IN ATMEL'S TERMS AND CONDITIONS OF SALE LOCATED ON ATMEL'S WEB SITE, ATMEL ASSUMES NO LIABILITY WHATSOEVER AND DISCLAIMS ANY EXPRESS, IMPLIED OR STATUTORY WARRANTY RELATING TO ITS PRODUCTS INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTY OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, OR NON-INFRINGEMENT. IN NO EVENT SHALL ATMEL BE LIABLE FOR ANY DIRECT, INDIRECT, CONSEQUENTIAL, PUNITIVE, SPECIAL OR INCIDENTAL DAMAGES (INCLUDING, WITHOUT LIMITATION, DAMAGES FOR LOSS OF PROFITS, BUSINESS INTERRUPTION, OR LOSS OF INFORMATION) ARISING OUT OF THE USE OR INABILITY TO USE THIS DOCUMENT, EVEN IF ATMEL HAS BEEN ADVISED OF THE POSSIBILITY OF SUCH DAMAGES.** Atmel makes no representations or warranties with respect to the accuracy or completeness of the contents of this document and reserves the right to make changes to specifications and product descriptions at any time without notice. Atmel does not make any commitment to update the information contained herein. Unless specifically provided otherwise, Atmel products are not suitable for, and shall not be used in, automotive applications. Atmel's products are not intended, authorized, or warranted for use as components in applications intended to support or sustain life.

© 2008 Atmel Corporation. All rights reserved. Atmel®, logo and combinations thereof, and others are registered trademarks or trademarks of Atmel Corporation or its subsidiaries. Other terms and product names may be trademarks of others.

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

[Atmel:](#)

[AT80C51ID2-RLTUL](#) [AT80C51ID2-RLTUM](#) [AT80C51ID2-SLSUL](#) [AT80C51ID2-SLSUM](#)



Компания «ЭлектроПласт» предлагает заключение долгосрочных отношений при поставках импортных электронных компонентов на взаимовыгодных условиях!

Наши преимущества:

- Оперативные поставки широкого спектра электронных компонентов отечественного и импортного производства напрямую от производителей и с крупнейших мировых складов;
- Поставка более 17-ти миллионов наименований электронных компонентов;
- Поставка сложных, дефицитных, либо снятых с производства позиций;
- Оперативные сроки поставки под заказ (от 5 рабочих дней);
- Экспресс доставка в любую точку России;
- Техническая поддержка проекта, помощь в подборе аналогов, поставка прототипов;
- Система менеджмента качества сертифицирована по Международному стандарту ISO 9001;
- Лицензия ФСБ на осуществление работ с использованием сведений, составляющих государственную тайну;
- Поставка специализированных компонентов (Xilinx, Altera, Analog Devices, Intersil, Interpoint, Microsemi, Aeroflex, Peregrine, Syfer, Eurofarad, Texas Instrument, Miteq, Cobham, E2V, MA-COM, Hittite, Mini-Circuits, General Dynamics и др.);

Помимо этого, одним из направлений компании «ЭлектроПласт» является направление «Источники питания». Мы предлагаем Вам помощь Конструкторского отдела:

- Подбор оптимального решения, техническое обоснование при выборе компонента;
- Подбор аналогов;
- Консультации по применению компонента;
- Поставка образцов и прототипов;
- Техническая поддержка проекта;
- Защита от снятия компонента с производства.



Как с нами связаться

Телефон: 8 (812) 309 58 32 (многоканальный)

Факс: 8 (812) 320-02-42

Электронная почта: org@eplast1.ru

Адрес: 198099, г. Санкт-Петербург, ул. Калинина, дом 2, корпус 4, литера А.