



CONNECTOR TYPE	CABLE TYPE	TOOLS REQUIRED:
OSM RIGHT ANGLE CABLE PLUG CRIMP ATTACH	RG 180/U, 195	LOCATOR TOOL: 2098-5218-02 (T-2367) CRIMP TOOL: 2098-0105-54 DIE NO. D

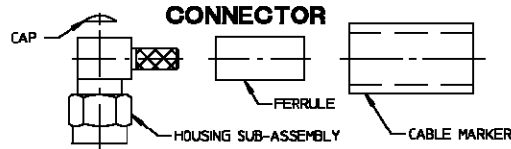


ASSEMBLY OPERATIONS

- 1.0 PREPARE COAXIAL CABLE END.
 - 1.1 PLACE CABLE MARKER AND FERRULE ON CABLE.
 - 1.2 REMOVE END PORTION OF CABLE JACKET TO EXPOSE CABLE OUTER CONDUCTOR.
 - 1.3 TRIM OUTER CONDUCTOR TO LENGTH.
 - 1.4 TRIM CABLE DIELECTRIC TO LENGTH.
 - 1.5 TRIM INNER CONDUCTOR TO LENGTH.
 - 1.6 FLARE OUTER CONDUCTOR.

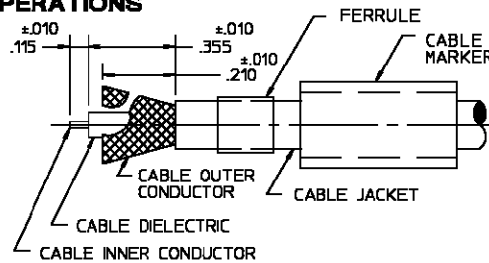


- 2.0 SOLDERING OF CABLE INNER CONDUCTOR HOUSING SUB-ASSEMBLY.
 - 2.1 SECURE LOCATOR TOOL TO THREADS OF HOUSING SUB-ASSEMBLY.
 - 2.2 POSITION AND SECURE HOUSING SUB-ASSEMBLY IN A SMALL BENCH VISE.
 - 2.3 TIN INNER CONDUCTOR OF CABLE.
 - 2.4 INSERT CABLE INTO HOUSING SUB-ASSEMBLY
 - 2.4.1. NEST INNER CONDUCTOR IN CONTACT SLOT
 - 2.4.2. HOLD CABLE DIELECTRIC AND INNER CONDUCTOR FLUSH AS SHOWN.
 - 2.5 PLACE SOLDERING IRON ON TIP OF CONTACT AND SOLDER.

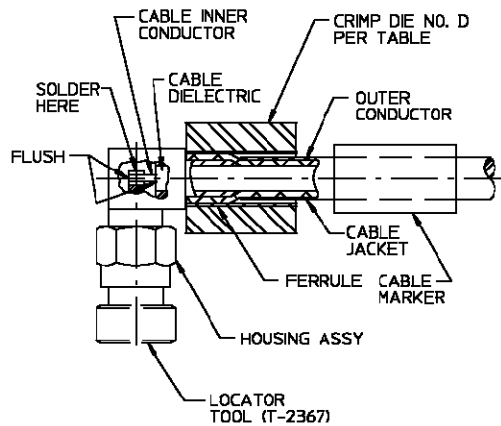


- 3.0 CRIMPING OF CABLE SUB-ASSEMBLY TO HOUSING SUB-ASSEMBLY.
 - 3.1 SLIDE FERRULE OVER FLARED PORTION OF OUTER CONDUCTOR.
 - 3.2 CRIMP FERRULE IN PLACE.
 - 3.3 TRIM AND REMOVE EXCESS OUTER CONDUCTOR STRANDS.

- 4.0 SEAL OPENING IN HOUSING
 - 4.1 PRESS CAP INTO OPENING IN REAR HOUSING SUB-ASSEMBLY. CAP MAY BE EPOXIED INTO PLACE. DO NOT ALLOW EPOXY TO PENETRATE INSIDE HOUSING.
 - 4.2 REMOVE LOCATOR TOOL.

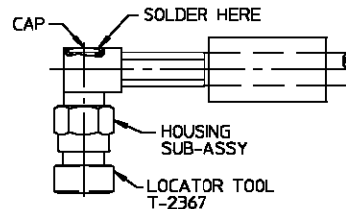

- 5.0 SHRINK CABLE MARKER TO CABLE
 - 5.1 POSITION CABLE MARKER OVER FERRULE AS SHOWN.
 - 5.2 APPLY INDIRECT HEAT WITH THERMO GUN TO CABLE MARKER.
 - 5.3 REMOVE LOCATOR TOOL.
 - 5.4 ASSEMBLY IS NOW COMPLETE

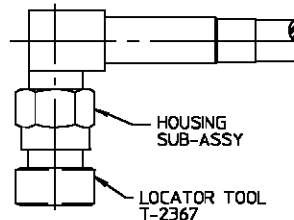



Компания «ЭлектроПласт» предлагает заключение долгосрочных отношений при поставках импортных электронных компонентов на взаимовыгодных условиях!

Наши преимущества:

- Оперативные поставки широкого спектра электронных компонентов отечественного и импортного производства напрямую от производителей и с крупнейших мировых складов;
- Поставка более 17-ти миллионов наименований электронных компонентов;
- Поставка сложных, дефицитных, либо снятых с производства позиций;
- Оперативные сроки поставки под заказ (от 5 рабочих дней);
- Экспресс доставка в любую точку России;
- Техническая поддержка проекта, помощь в подборе аналогов, поставка прототипов;
- Система менеджмента качества сертифицирована по Международному стандарту ISO 9001;
- Лицензия ФСБ на осуществление работ с использованием сведений, составляющих государственную тайну;
- Поставка специализированных компонентов (Xilinx, Altera, Analog Devices, Intersil, Interpoint, Microsemi, Aeroflex, Peregrine, Syfer, Eurofarad, Texas Instrument, Miteq, Cobham, E2V, MA-COM, Hittite, Mini-Circuits, General Dynamics и др.);

Помимо этого, одним из направлений компании «ЭлектроПласт» является направление «Источники питания». Мы предлагаем Вам помощь Конструкторского отдела:

- Подбор оптимального решения, техническое обоснование при выборе компонента;
- Подбор аналогов;
- Консультации по применению компонента;
- Поставка образцов и прототипов;
- Техническая поддержка проекта;
- Защита от снятия компонента с производства.



Как с нами связаться

Телефон: 8 (812) 309 58 32 (многоканальный)

Факс: 8 (812) 320-02-42

Электронная почта: org@eplast1.ru

Адрес: 198099, г. Санкт-Петербург, ул. Калинина, дом 2, корпус 4, литера А.