



Scotchlok™ Y (Yellow)

Insulated Electrical Spring Connector

Data Sheet



Application

Use a Y Scotchlok™ connector to electrically connect two or more conductor ends in a pigtail application and insulate the connection, or insulate a single conductor end.

Wire Range

AWG Range: solid or stranded copper conductors only. No. 22 thru No. 10 (0,75 mm² thru 2,5 mm²)

Construction

- Spring** Spring steel, Corrosion resistant coating
- Shell** Steel, Corrosion resistant coating
- Insulator** Flame Retardant Flexible Polyvinyl Chloride
Color- yellow

Weight

.0043 lb. (1.96 gm)

Engineering Specification

Electrical Spring Connector (as manufactured by 3M, part No. Y Scotchlok) capable of connecting two or more wires in a pigtail application, in the wire range of No. 22 thru No. 10 AWG solid or stranded copper conductors. The conductor shall have a corrosion resistant coating. The connector shall be constructed

of an active (live) spring and a steel shell covered by a vinyl insulator. The spring shall have a corrosion resistant coating. (The connector shall be UL Listed and CSA Certified as a pressure cable connector. The connector shall be voltage rated 600 volts maximum, building wire, 1000 volts maximum, signs, fixtures and luminaires. The connector shall have a maximum operating temperature of 105°C.

Regulatory Agencies



UL Listed as a Pressure Cable Connector
 Tested per UL Standard 486C
 UL File No. E23438
 Operating Temperature: 105°C (221°F)
 Voltage Rating: 600 volts max. building wire;
 1000 volts max. signs and fixtures
 Flammability Rating: UL94 V-2

CSA Certified-CSA Standard C22.2 No. 0, 188-M1983
 CSA File No. LR15503
 Operating Temperature: 105°C (221°F)
 Voltage Rating: 600 volts max. building wire
 1000 volts max. signs and luminaires.
 Flammability Rating: C22.2 No. 0.6 V-2

Federal Specification W-S-610:

“Commercial package only”

Type	Class	Kind	Style
1	1	cu	G

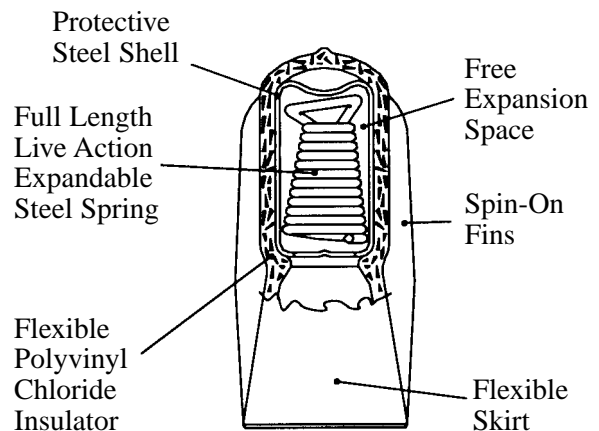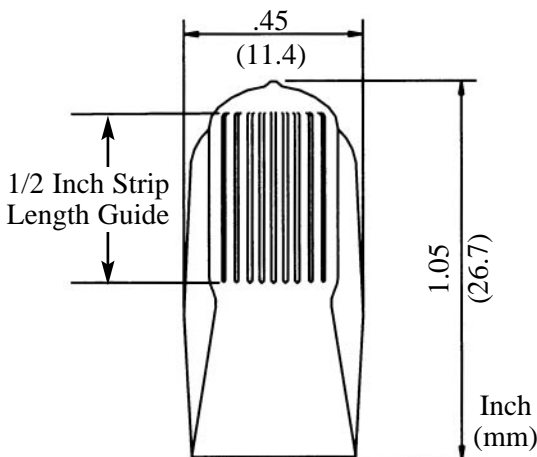

Scotchlok™ Y

AWG Wire Combinations Copper to Copper Conductors



□ = 300 volts
● = 600 volts

All wire combinations are 600 volt UL Listed when using conductors with insulation thickness such as TW and THHN.

UL Listed single wire terminations:
No: 10, 12 and 14 AWG



All wire combinations are 600 volts CSA Certified

22 STR	1	□ □																				
	2	□ □ □																				
	3	□ □ □ □																				
	4	□ □ □ □ □																				
	5	□ □ □ □ □																				
22 SOL	1	□ □	□ □																			
	2	□ □ □	□ □ □	□ □																		
	3	□ □ □ □	□ □ □ □	□ □ □	□ □																	
	4	□ □ □ □ □	□ □ □ □ □	□ □ □ □	□ □ □	□ □																
	5	□ □ □ □ □	□ □ □ □ □	□ □ □ □ □	□ □ □ □	□ □ □	□ □															
20 STR	1	□ □	□ □	□ □																		
	2	□ □ □	□ □ □	□ □ □	□ □																	
	3	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □	□ □																
	4	□ □ □ □ □	□ □ □ □ □	□ □ □ □ □	□ □ □ □	□ □ □	□ □															
	5	□ □ □ □ □	□ □ □ □ □	□ □ □ □ □	□ □ □ □ □	□ □ □ □	□ □ □	□ □														
20 SOL	1	□ □	□ □	□ □	□ □																	
	2	□ □ □	□ □ □	□ □ □	□ □ □	□ □																
	3	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □	□ □															
	4	□ □ □ □ □	□ □ □ □ □	□ □ □ □ □	□ □ □ □ □	□ □ □ □	□ □ □	□ □														
	5	□ □ □ □ □	□ □ □ □ □	□ □ □ □ □	□ □ □ □ □	□ □ □ □ □	□ □ □ □	□ □ □	□ □													
18 STR	1	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	● ● ● □															
	2	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	● ● ● □	● ● ● □														
	3	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	● ● ● □	● ● ● □	● ● ● □													
	4	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	● ● ● □	● ● ● □	● ● ● □	● ● ● □												
	5	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● ● □											
18 SOL	1	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	● ● ● □	● ● ● □														
	2	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	● ● ● □	● ● ● □	● ● ● □													
	3	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	● ● ● □	● ● ● □	● ● ● □	● ● ● □												
	4	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● ● □											
	5	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	□ □ □ □	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● ● □										
16 STR	1	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● □	● ● □														
	2	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● □	● ● □	● ● □													
	3	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● □	● ● □	● ● □	● ● □	● ● □											
16 SOL	1	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● □	● ● □	● ● □													
	2	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● □	● ● □	● ● □	● ● □												
	3	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● □	● ● □	● ● □	● ● □	● ● □											
	4	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● □	● ● □	● ● □	● ● □	● ● □	● ● □										
14 STR	1	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● □	● ● □	● ● □	● ● □												
	2	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● □	● ● □	● ● □	● ● □	● ● □											
14 SOL	1	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● □	● ● □	● ● □	● ● □	● ● □											
	2	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● □	● ● □	● ● □	● ● □	● ● □	● ● □										
12 STR	1	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● □	● ● □	● ● □	● ● □	● ● □	● ● □										
	2	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● □	● ● □	● ● □	● ● □	● ● □	● ● □	● ● □									
12 SOL	1	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● □	● ● □	● ● □	● ● □	● ● □	● ● □	● ● □									
	2	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● ● □	● ● □	● ● □	● ● □	● ● □	● ● □	● ● □	● ● □	● ● □								
10 STR	1						●	●	●													
10 SOL	1						●	●	●													
		1 2 3 4 5	1 2 3 4 5	1 2 3 4 5	1 2 3 4 5	1 2 3 4	1 2 3 4	1 2	1 2	1 2	1 2	1 2	1 2	1	1							
		22 STR	22 SOL	20 STR	20 SOL	18 STR	18 SOL	16 STR	16 SOL	14 STR	14 SOL	12 STR	12 SOL									

How to read this chart:

Example 1:
2 No. 16 str.
+ 3 No. 18 sol. (5)

Example 2:
1 No. 14 str.
+ 2 No. 16 sol. (3)

Installation Instructions

WARNING

Turn power off before installing or removing terminal. All electrical work should be done according to appropriate electrical codes.

1. Strip wire insulation 1/2 inch (12.7 mm) from the end of the wires to be connected.
2. Firmly grasp wires, making sure insulation ends are even and tightly bundled. (wires may be twisted or untwisted). Slip connector over wire tips.
3. Turn connector onto wires in a clockwise direction until secure.
4. To remove, turn connector counter-clockwise.

Metric Wire Combinations

Copper Conductors Only


Conductor Combinations	
Minimum	Maximum
2,0mm ²	7,5mm ²

Conductor Combinations		
Quantity	Size	Type
3-6	0,75mm ²	sol/str
2-6	1,0mm ²	sol/str
2-4	1,0mm ²	sol/str
2-3	2,5mm ²	sol/str

Only AWG combinations are UL Listed or CSA Certified.

3M and Scotchlok are trademarks of 3M Company.

 is a trademark of Underwriters Laboratories.

 is a trademark of Canadian Standards Association.

IMPORTANT NOTICE

Before using this product, you must evaluate it and determine if it is suitable for your intended application. You assume all risks and liability associated with such use.

Warranty; Limited Remedy; Limited Liability. This product will be free from defects in material and manufacture as of the date of purchase. **3M MAKES NO OTHER WARRANTIES INCLUDING, BUT NOT LIMITED TO, ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE.** If this product is defective within the warranty period stated above, your exclusive remedy shall be, at 3M's option, to replace or repair the 3M product or refund the purchase price of the 3M product. **Except where prohibited by law, 3M will not be liable for any loss or damage arising from this 3M product, whether direct, indirect, special, incidental or consequential regardless of the legal theory asserted.**

3M

Electrical Products Division

6801 River Place Blvd.
Austin, TX 78726-9000
www.3M.com/elpd

Litho in USA
©3M 2003 78-8126-5511-2-A



Компания «ЭлектроПласт» предлагает заключение долгосрочных отношений при поставках импортных электронных компонентов на взаимовыгодных условиях!

Наши преимущества:

- Оперативные поставки широкого спектра электронных компонентов отечественного и импортного производства напрямую от производителей и с крупнейших мировых складов;
- Поставка более 17-ти миллионов наименований электронных компонентов;
- Поставка сложных, дефицитных, либо снятых с производства позиций;
- Оперативные сроки поставки под заказ (от 5 рабочих дней);
- Экспресс доставка в любую точку России;
- Техническая поддержка проекта, помощь в подборе аналогов, поставка прототипов;
- Система менеджмента качества сертифицирована по Международному стандарту ISO 9001;
- Лицензия ФСБ на осуществление работ с использованием сведений, составляющих государственную тайну;
- Поставка специализированных компонентов (Xilinx, Altera, Analog Devices, Intersil, Interpoint, Microsemi, Aeroflex, Peregrine, Syfer, Eurofarad, Texas Instrument, Miteq, Cobham, E2V, MA-COM, Hittite, Mini-Circuits, General Dynamics и др.);

Помимо этого, одним из направлений компании «ЭлектроПласт» является направление «Источники питания». Мы предлагаем Вам помощь Конструкторского отдела:

- Подбор оптимального решения, техническое обоснование при выборе компонента;
- Подбор аналогов;
- Консультации по применению компонента;
- Поставка образцов и прототипов;
- Техническая поддержка проекта;
- Защита от снятия компонента с производства.



Как с нами связаться

Телефон: 8 (812) 309 58 32 (многоканальный)

Факс: 8 (812) 320-02-42

Электронная почта: org@eplast1.ru

Адрес: 198099, г. Санкт-Петербург, ул. Калинина, дом 2, корпус 4, литера А.