CSM_XS2_DS_E_4_2


Water- and Environment-resistive FA Connectors Save Wiring and Maintenance Effort

- Compact FA connectors meet IP67 requirements and ensure a 94V-0 fire retardant rating.
- A wide array of connectors makes a wiring system more modular, simplifies maintenance, and reduces downtime.
- Connectors with Cables and Connector Assemblies are available.
- Three types of Connector Assembly: Crimping, soldering, and screw-on.
- Connectors with Cables are UL certified.
- Based on IEC61076-2-101 (IEC 60947-5-2) and NECA 4202.



Refer to Safety Precautions on page 20.

Construction (XS2G Soldering Connector Plug Assemblies)

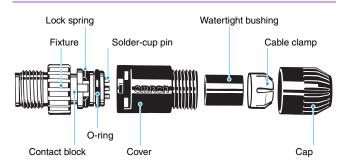

Ratings and Specifications

Rated current	3 A		
Rated voltage	For DC 125 VDC, for AC 250 VAC		
Contact resistance (Connector)	40 mΩ max. (20 mV max., 100 mA max.)		
Insulation resistance	1,000 MΩ min. (at 500 VDC)		
Dielectric strength (Connector)	1,500 VAC for 1 min (leakage current: 1 mA max.).		
Degree of protection	IP67 (IEC529)		
Insertion tolerance	200 times min.		
Assembled fixture strength	Tensile: 98 N/15 s Torsion: 0.98 N·m/15 s		
Cable holding strength	Cable diameter: 6 mm 98 N/15 s 4 to 5 mm 49 N/15 s 3 mm 29 N/15 s		
Ambient operating temperature range	Operating: – 25°C to 70°C		
Ambient humidity range	20% to 85%		

Recommended Cables

Cable outer diameter		Core sizes					
		Crimping models Soldering models		Screw-on models			
8 mm	7 to 8 mm						
7 mm	6 to 7 mm			0.18 to 0.75 mm ²			
6 mm	5 to 6 mm	Two types of contacts					
4 mm	4 to 5 mm	are available. • 0.18 to 0.3 mm ²	0.5 mm ² max.	0.75 mm-			
3 mm	3 to 4 mm	• 0.5 to 0.75 mm ²					

Materials and Finish

Ite	m	XS2F/H/W	XS2M/R/P	XS2C/G	
Contacts	Contacts Materials		Brass		
	Finish	Nickel base, 0.4-	μm gold plating		
Thread	Materials	Brass *			
bracket	Finish	Nickel plated *			
Pin block	Materials	PBT resin (UL94V-0)	PA resin (UL94V-0)	PBT resin (UL94V-0)	
	Finish	For DC: light gra	y; for AC: dark gr	ay	
O-ring/rubbe	er bushing	Rubber			
Cover		PBT resin (UL94V-0)		PBT resin (UL94V-0)	
Сар	Сар			PBT resin (UL94V-0)	
Cable clamp	Cable clamp			PA resin (UL94V-0)	
Pin clamp				PBT resin (UL94V-0)	
Lock spring	Lock spring			LCP resin (UL94V-0)	
Watertight b	Watertight bushing			Rubber	
Ring				Steel	

^{*}The T-joint of the XS2R is aluminum/white.

Socket Appearance

DC	type	AC type		
Male (plug) contacts	Female (socket) contacts	Male (plug) contacts	Female (socket) contacts	
	5 0 2 0 0 0 0 0 1 1 1 0		(D)	


Note: The AC and DC connectors are different as shown here and therefore cannot be connected together.

List of Products

Name	Мо	del	Appearance
	XS2W Sockets and Plugs	on Cable Ends	
1. Connectors attached to Cable	XS2F Sockets on One Ca	ble End	
	XS2H Plugs on One Cable	e End	
	XS2G Plug Assemblies		
	XS2C Socket Assemblies		onnon.
Connector Assemblies (Crimping, Soldering, or Screw-on) Used to enable using connectors for sensor cables and relay cables.	XY2F Crimp Tool (for Crin	nping Connectors)	
cables.	XW4Z Screwdriver (for Sc	erew-on Connectors)	
3. Terminal Box Connectors			n#0
Used to enable using connectors for terminal boxes.	XS2P Panel-mounting So	ckets	
4. T-Joints and Y-Joints	XS2R T-Joint/Y-Joint	T-Joints	C C C C C C C C C C C C C C C C C C C
Used for branching and for daisy-chain connections.	Plug/Socket Connectors	Y-Joints	O COURT
5. Sensor Connector Assemblies		Embedded Plugs with Screw Threads	
Used to enable using connectors in sensors.	XS2M Plugs	Embedded Plugs with No Screw Threads	
6. Panel-mounting Connectors Used to enable using I/O box connectors mounted to panels.	VCOM Plugo	Flange-mounting Plugs	
	XS2M Plugs	Screw-mounting Plugs	

XS2W Sockets and Plugs on Cable Ends

Model Number Legend





1. Type

W: Connectors connected to cable, socket and plug on cable ends

2. AC/DC (Mating Section Form)

D: For DC

3. Connector Poles

4: 4 poles

5: 5 poles

4. Contact Plating

2: 0.4-µm gold plating

5. Cable Connection Direction

- 1: Straight/straight
- 2: L-shaped/L-shaped
- 3: Straight (XS2F)/L-shaped (XS2H)
- 4: L-shaped (XS2F)/straight (XS2H)

6. Cable Length

A: 0.3 m (straight/straight only)

B: 0.5 m (straight/straight only)

C: 1 m (straight/straight only)

D: 2 m

E: 3 m (straight/straight only)

F: 4 m (straight/straight only)

G: 5 m

H: 7 m (straight/straight only)

J: 10 m (straight/straight only)

K: 15 m (straight/straight only)

L: 20 m (straight/straight only)

7. Connections



8. Connectors on One End/Both Ends

1: Both ends

9. Cable Specifications

A: Standard cable

R: Vibration-proof robot cable (straight/straight only)

F: Fire-retardant, vibration-proof cable

XS2W Sockets and Plugs on Cable Ends


Connectors with Standard Cable

XS2W-D42□-□81-A


● Connectors with Vibration-proof Robot Cable (Straight/Straight) XS2W-D421-□81-R

Dimensions (Unit: mm)


Straight/Straight Connectors

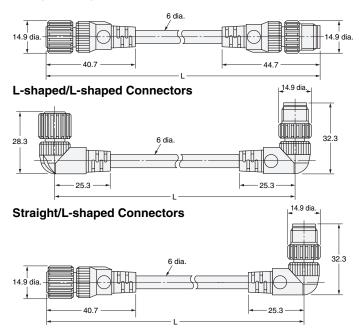


Wiring Diagram for 4 Cores



L-shaped/Straight Connectors



Wiring Diagram for 5 Cores



Ordering Information


Cable type	Cable connection	No. of cable	Cable core cross-	Cable	DC		UL-listed												
	direction	cores	sectional area (mm²)	length (m)	Model	Minimum order	OL Hoteu												
Standard ca-	Straight/Straight			1	XS2W-D421-C81-A	10													
ble				2	XS2W-D421-D81-A	10													
				5	XS2W-D421-G81-A	5													
				10	XS2W-D421-J81-A	- 5	i												
	L-shaped/L-shaped	=		2	XS2W-D422-D81-A	10													
				5	XS2W-D422-G81-A	5													
	Straight/L-shaped		4	4	4	4	4	4	4	4	4	4	1	0.5	4 0.5	2	XS2W-D423-D81-A	10	Yes
	J	4	0.5	5	XS2W-D423-G81-A	5	res												
	L-shaped/Straight	=		2	XS2W-D424-D81-A	10													
				5	XS2W-D424-G81-A	5													
Vibration-	Straight/Straight	=		1	XS2W-D421-C81-R	10													
proof robot	Juaiging Guraigini		2	XS2W-D421-D81-R	10														
cable				5	XS2W-D421-G81-R	5													
				10	XS2W-D421-J81-R	5													

Note: Ask your OMRON representative about other cable lengths, and about 5-core cables.

XS2F Socket on One Cable End

Model Number Legend

Use this model number legend to identify products from their model number. When ordering, use a model number from the table in Ordering Information.



1. Type

F: Connector connected to cable, socket on one cable end

2. AC/DC (Mating Section Form)

A: For AC

D: For DC

E: For DC. stainless steel lock

3. Connector Poles

4: 4 poles

5: 5 poles

4. Contact Plating

2: 0.4-µm gold plating

5. Cable Connection Direction

1: Straight

2: L-shaped

6. Cable Length

A: 0.3 m

B: 0.5 m

C: 1 m

D: 2 m

E: 3 m

F: 4 m

G: 5 m

H: 7 m J: 10 m

K: 15 m

L: 20 m

Only the 2 m (D) and 5 m (G) cables are available for cables with 5 poles.

7. Connections

Terminal No.

A: Brown --- Blue (for DC)
B: --- Brown Blue (for DC)
C: Brown --- Blue Black
D: --- Blue Brown
8: Brown White Blue Black (for DC)
9: Brown White Blue Black (for AC)

8. Connectors on One End/Both Ends

0: One end

9. Cable Specifications

A: Standard cable

R: Vibration-proof robot cable

F: Fire-retardant, vibration-proof cable

E: Heat-resistant cable up to 105°C

R type is a 2- or 4-core cable. F or E type is a 4-core cable.

Designations for DC Polarity (For Limit Switches and Sensors)

6. Cable Length

3: 2 m

4: 5 m

7. Connections

Pin No.

① ② ③ ④ --- Black White

8. Connectors on One End/Both Ends

0: One end

9. Cable Specifications

Not designated.

Note: Model number standards are different for items 6, 7, and 9 for non-polar connectors.

Terminal No.


① ② ③ ④ ⑤
G: Brown White Blue Black Gray

XS2F Sockets on One Cable End


- Connectors with Standard Cable XS2F-□42□-□□0-A
- Connectors with Vibration-proof Robot Cable XS2F-□42□-□□0-R
- Non-polar DC Connectors with Standard Cable XS2F-□42□-□□0

Dimensions (Unit: mm)


Straight Connectors



L-shaped Connectors

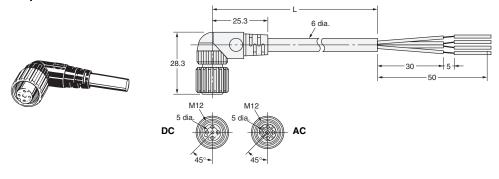

Wiring Diagram

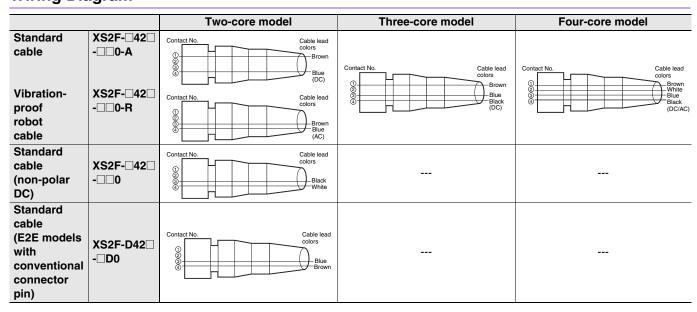

Ordering Information

	Cable	No. of	Cable core	Cable	DC	AC	Minimum	UL-
Cable type	connection direction	cable cores	cross-sectional area (mm²)	length (m)	Model	Model	order	listed
		2			XS2F-D421-CA0-A	XS2F-A421-CB0-A		
		3		1	XS2F-D421-CC0-A			
		4			XS2F-D421-C80-A	XS2F-A421-C90-A		
		2			XS2F-D421-DA0-A	XS2F-A421-DB0-A	10	
		3		2	XS2F-D421-DC0-A			
		4			XS2F-D421-D80-A	XS2F-A421-D90-A		
	Straight	2			XS2F-D421-GA0-A	XS2F-A421-GB0-A		1
		3		5	XS2F-D421-GC0-A		1	
		4			XS2F-D421-G80-A	XS2F-A421-G90-A	_	
		2			XS2F-D421-JA0-A	XS2F-A421-JB0-A	5	
		3		10	XS2F-D421-JC0-A		<u> </u>	
Ctondoud coblo		4			XS2F-D421-J80-A	XS2F-A421-J90-A	†	
Standard cable		2	•		XS2F-D422-CA0-A	XS2F-A422-CB0-A		
		3		1	XS2F-D422-CC0-A			
		4			XS2F-D422-C80-A		10	
		2			XS2F-D422-DA0-A	XS2F-A422-DB0-A	10	
		3		2	XS2F-D422-DC0-A			
	Labanad	4			XS2F-D422-D80-A			
	L-shaped	2			XS2F-D422-GA0-A	XS2F-A422-GB0-A		
		3		5	XS2F-D422-GC0-A			Yes
		4			XS2F-D422-G80-A		5	res
		2			XS2F-D422-JA0-A	XS2F-A422-JB0-A	5	
		3		10	XS2F-D422-JC0-A			
		4			XS2F-D422-J80-A			
		2	0.5	1	XS2F-D421-CA0-R	XS2F-A421-CB0-R		
		4		ı	XS2F-D421-C80-R	XS2F-A421-C90-R	10	
		2	2	XS2F-D421-DA0-R	XS2F-A421-DB0-R	10		
	Straight	4		_	XS2F-D421-D80-R	XS2F-A421-D90-R		
	Straight	2		5	XS2F-D421-GA0-R	XS2F-A421-GB0-R		
		4		3	XS2F-D421-G80-R	XS2F-A421-G90-R	5	
		2		10	XS2F-D421-JA0-R	XS2F-A421-JB0-R	3	
Vibration-proof		4		10	XS2F-D421-J80-R	XS2F-A421-J90-R		
robot cable		2		1	XS2F-D422-CA0-R	XS2F-A422-CB0-R		
		4		•	XS2F-D422-C80-R		10	
		2		2	XS2F-D422-DA0-R	XS2F-A422-DB0-R		
	L-shaped	4		_	XS2F-D422-D80-R			
	_ 0ap 0 a	2		5	XS2F-D422-GA0-R	XS2F-A422-GB0-R		
		4			XS2F-D422-G80-R		5	
		2		10	XS2F-D422-JA0-R	XS2F-A422-JB0-R		
		4			XS2F-D422-J80-R			
	Straight	2		2	XS2F-D421-310	XS2F-A421-310	10	
Standard cable		2		5	XS2F-D421-410	XS2F-A421-410	5	
(non-polar)	L-shaped	2		2	XS2F-D422-310	XS2F-A422-310	10	
	'	2		5	XS2F-D422-410	XS2F-A422-410	5	
Standard cable	Straight	2		2	XS2F-D421-DD0		10	-
(E2E models		2		5	XS2F-D421-GD0		5	
with conventional connector pin)	L-shaped	2		2	XS2F-D422-DD0		10	-
Connector pin)		2		5	XS2F-D422-GD0		5	
	Straight			2	XS2F-E421-D80-E		10	
Heat-resistant		4		5	XS2F-E421-G80-E		5	
cable *	L-shaped			2	XS2F-E422-D80-E		10	-
	·			5	XS2F-E422-G80-E		5	

Note: Ask your OMRON representative about other cable lengths.


*The heat-resistant fixture material is SUS316L stainless steel without surface treatment.

Applicable Proximity Sensors

Refer to page the E2E Datasheet for information on connecting to E2E Proximity Sensors

● 5-pole Connectors for DC XS2F-D521-□G0-A

Dimensions (Unit: mm)

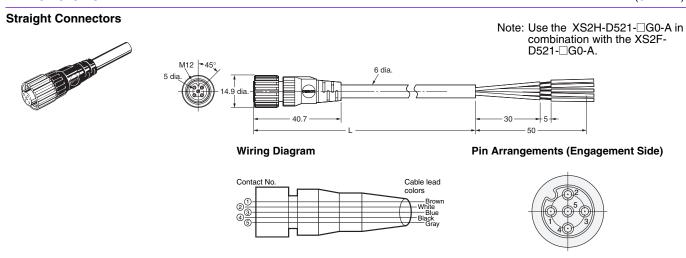

Ordering Information

No. of cable	Cable core Cable length		DC		
cores	cross-sectional area (mm²)	(m)	Model	Minimum order	
5	0.3 mm ²	2	XS2F-D521-DG0-A	10	
	5 0.3 11111-		XS2F-D521-GG0-A	5	

Note: Ask your OMRON representative about other cable lengths.

Using this model number legend to identify products from their

model number. When ordering, use a model number from the

table in Ordering Information.

XS2H Plugs on One Cable End

Model Number Legend



1. Type

H: Connector connected to cable, plug on one cable end

2. AC/DC

- A: For AC
- D: For DC

3. Connector Poles

- 4: 4 poles
- 5: 5 poles

4. Contact Plating

2: 0.4-µm gold plating

5. Cable Connection Direction

1: Straight

6. Cable Length

- A: 0.3 m
- B: 0.5 m
- C: 1 m
- D: 2 m
- G: 5 m

7. Connections

 Terminal No.
 Terminal No.
 Terminal No.

 ①
 ②
 ③
 ④
 ①
 ②
 ③
 ④

- 8: Brown White Blue Black (for DC)
- A: Brown --- Blue (for DC)
- 9: Brown White Blue Black (for AC) B: --- Brown Blue (for AC)
 - Willie Blue Black (IDI AO) B. --- Blowil Blue (IDI AO)
- C: Brown --- Blue Black(for DC)

8. Connectors on One End/Both Ends

0: One end

9. Cable Specifications

- A: Standard cable
- F: Fire-retardant, vibration-proof cable
- R: Vibration-proof robot cable
- R type is a 2 or 4-core cable. F type is a 4-core cable.

(5)

G: Brown White Blue Black Gray


XS2H Plugs on One Cable End

● Connectors on Standard Cable XS2H-□421-□□0-A


Dimensions (Unit: mm)


Straight Connectors






Wiring Diagram

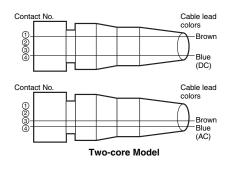





Three-core Model


Four-core Model

● Connectors on DC Cable (Five Poles) XS2H-D521-□G0-A (for DC)


Dimensions (Unit: mm)


Straight Connectors





Wiring diagram





Note: Use the XS2F-D521-□G0-A in combination with the XS2H-D521-



Ordering Information

No. of con-	Cable connec-	No. of	Cable core cross-	Cable	DC	AC	Minimum	UL-							
nector poles	tion direction	cable cores	sectional area	length (m)	Model	Model	order	listed							
		2			XS2H-D421-AA0-A	XS2H-A421-AB0-A									
		3		0.3	XS2H-D421-AC0-A										
4		4	0.5 mm ²	0 F mm²	0.5 mm2	0.5 mm²	0.F.mm2		XS2H-D421-A80-A	XS2H-A421-A90-A		Yes			
4	Ctroight	2		0.5 11111	XS2H-D421-CA0-A	XS2H-A421-CB0-A	10	165							
	Straight 3	3					1	1		1	1	XS2H-D421-CC0-A		10	
		4				XS2H-D421-C80-A	XS2H-A421-C90-A								
5		5	0.3 mm ²	0.3	XS2H-D521-AG0-A		1								
5	3	0.3 111111	1	XS2H-D521-CG0-A											



XS2 Sensor I/O Connectors on Cables (8-pole)

Ordering Information

Connector type	Cable connection direction	Number of cores	Cable length (m)	Model
Panal mounting applied				XS2P-D821-2
Panel-mounting socket				XS2P-D822-2
Panel-mounting plug				XS2M-D824-4
Diverse		8	0.3	XS2H-D821-AH0-C
Plug on one cable end			1	XS2H-D821-CH0-C
Socket on one cable end	Straight		2	XS2F-D821-DH0-C
Socket on one cable end	Straight		5	XS2F-D821-GH0-C
Plug and pooket on poble ands			2	XS2W-D821-DH1-C
Plug and socket on cable ends			5	XS2W-D821-GH1-C

Pin Numbers and Cable Lead Colors

		Pin number						
XS2F/XS2H/XS2W cable lead	1	2	3	4	5	6	7	8
colors	White	Brown	Green	Yellow	Gray	Pink	Blue	Shield

Ratings and Characteristics


Rated current	1.5 A
Rated voltage	36 VDC
Contact resistance	40 MΩ max.
Contact resistance	(at 20 mVDC max. and 100 mA max.)
Insulation resistance	1,000 MΩ min. (at 500 VDC)
Diologicia atropath	1,000 VAC for 1 min
Dielectric strength	(leakage current: 1 mA max.)
Degree of protection	IP67
Insertion durability	200 times min.
Operating temperature	−25 to 70°C

Materials and Finish

Contacts	Brass/nickel base,
Contacts	0.4-μm goldplating
Bracket, body, M16 nuts	Brass/nickel plated
Pin block	PBT resin (UL94V-0)/light gray
Cover *1	PBT resin (UL94V-0)
Seal rubber and O-ring *2	Rubber

- *1. XS2F/XS2H/XS2W only.
- *2. O-rings are on sockets only.


Wiring Example

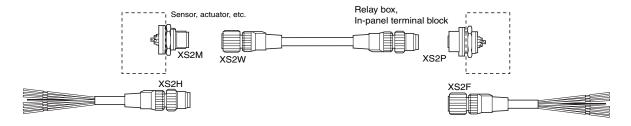

Dimensions (Unit: mm)


XS2H Plug on One Cable End (M12)






XS2F Socket on One Cable End (M12)






XS2W Plug and Socket on Cable Ends (M12)







XS2P-D821-2 Panel-mounting Socket (M12) with Solder Cup Pins and Rear Lock

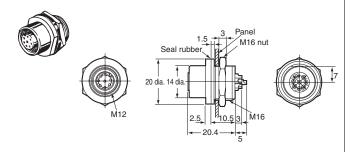

XS2M-D824-4 Panel-mounting Plug (M12) with Solder Cup Pins and Front Lock

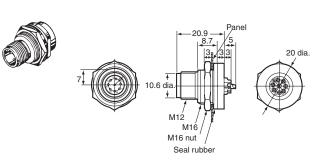

XS2P-D822-2 Panel-mounting Socket (M12) with Solder Cup Pins and Front Lock

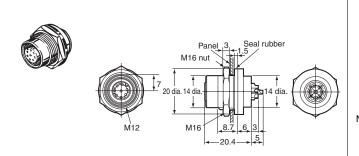

Panel Cutouts Connector Pin Numbers

(from Mating Side) 16*0.2 dia. 24 min. Plug Socket

Note 1. Mounting panel thickness: 1 to 4 mm.


- 2. Applicable core wire size for solder cup pins: 0.5 mm² max.
- 3. The M16 nut and seal rubber are included.

XS2G Crimping/Soldering Plug Assemblies

Dimensions (Unit: mm)

XS2G-□4C□ (Crimping Model) XS2G-□42□ (Soldering Model) **Straight Connectors**








XS2G-D42□ (Soldering Model) **L-shaped Connectors**





Ordering Information


Suitable cable dia.	Cable connection	Connection	DC	AC	Minimum
(mm)	direction	method	Model	Model	order
6-mm-dia, model	Ctroight	Crimping	XS2G-D4C1	XS2G-A4C1	
(5 to 6 mm dia.)	Straight	Soldering	XS2G-D421	XS2G-A421	
(5 to 6 min dia.)	L-shaped	Soldering	XS2G-D422		
A mana dia maadal	Ctroight	Crimping	XS2G-D4C3	XS2G-A4C3	
4-mm-dia. model (4 to 5 mm dia.)	Straight	Soldering	XS2G-D423	XS2G-A423	50
(4 to 5 min dia.)	L-shaped	Soldering	XS2G-D424		
3-mm-dia. model (3 to 4 mm dia.)	Ctuciolet	Crimping	XS2G-D4C5	XS2G-A4C5	
	Straight	Soldering	XS2G-D425	XS2G-A425	
	L-shaped	Soldering	XS2G-D426		

Note: Crimping plug contacts are sold separately.

XS2U Crimping Pin for XS2G

Dimensions (Unit: mm)

XS2U-312□ (Plug Pin)



Note: A special tool must be used for crimping. For details, refer to page 23.

Dimensions

Model	Suitable core size	Dimension (mm)		No. of slits	
	(mm²)	Α	В	С	SIIIS
XS2U-3121	0.18 to 0.3	20.0	6.1	8.0	1
XS2U-3122	0.5 to 0.75	20.1	6.2	1.3	0

Ordering Information

Suitable core size (mm²)	Model	Minimum order
0.18 to 0.3	XS2U-3121	100
0.5 to 0.75	XS2U-3122	100

Note: Orders are accepted in multiples of the minimum order.


XS2C Crimping/Soldering Socket Assemblies

Dimensions (Unit: mm)

XS2C-□4C□ (Crimping Model) XS2C-□42□ (Soldering Model)


Straight Connectors














Ordering Information


Suitable cable dia.	Cable connection	Connection method	DC	AC	Minimum orde
(mm)	direction	Connection method	Model	Model	
	Ctraight	Crimping	XS2C-D4C1	XS2C-A4C1	
6-mm-dia. model	Straight	Soldering	XS2C-D421	XS2C-A421	
(5 to 6 mm dia.)	Labanad	Crimping	XS2C-D4C2	XS2C-A4C2	
	L-shaped	Soldering	XS2C-D422	XS2C-A422	50
	Straight	Crimping	XS2C-D4C3	XS2C-A4C3	
4-mm-dia. model	Straight	Soldering	XS2C-D423	XS2C-A423	
(4 to 5 mm dia.)	Labanad	Crimping	XS2C-D4C4	XS2C-A4C4	
	L-Shapeu	Soldering	XS2C-D424	XS2C-A424	
3-mm-dia. model (3 to 4 mm dia.)	Straight	Crimping	XS2C-D4C5	XS2C-A4C5	
	Straight	Soldering	XS2C-D425	XS2C-A425	
	Labanad	Crimping	XS2C-D4C6	XS2C-A4C6	
	L-shaped	Soldering	XS2C-D426	XS2C-A426	

Note: Crimping plug contacts are sold separately.

XS2U Crimping Pin for XS2C

Dimensions (Unit: mm)

XS2U-222□ (Socket Pin)



Note: A special tool must be used for crimping. For details, refer to page 23.

Dimensions

Model	Suitable core size	Dimension (mm)		No. of	
	(mm²)	Α	В	С	Silts
XS2U-2221	0.18 to 0.3	16.7	6.1	8.0	1
XS2U-2222	0.5 to 0.75	16.8	6.2	1.3	0

Ordering Information

Suitable core size (mm²)	Model	Minimum order
0.18 to 0.3	XS2U-2221	100
0.5 to 0.75	XS2U-2222	100

Note: Orders are accepted in multiples of the minimum order.


XS2G Screw-on Plug Assemblies

Dimensions (Unit: mm)

XS2G-D5S7 (5-pole, Straight, Applicable Cable Outer Diameter: 8 mm) XS2G-D5S9 (5-pole, Straight, Applicable Cable Outer Diameter: 7 mm) XS2G-D4S7 (4-pole, Straight, Applicable Cable Outer Diameter: 8 mm) XS2G-D4S9 (4-pole, Straight, Applicable Cable Outer Diameter: 7 mm)








XS2G-D5S1 (5-pole, Straight, Applicable Cable Outer Diameter: 6 mm)
XS2G-D4S□ (4-pole, Straight, Applicable Cable Outer Diameter: 3, 4, or 6 mm)








XS2G-D5S2 (5-pole, L-shaped, Applicable Cable Outer Diameter: 6 mm)
XS2G-D4S□ (4-pole, L-shaped, Applicable Cable Outer Diameter: 3, 4, or 6 mm)





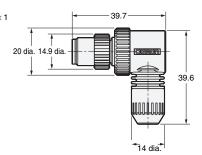

Ordering Information

No. of poles	Suitable cable dia. (mm)	Straight connectors (for DC)	L-shaped connectors (for DC)	Minimum order
No. or poles	Suitable Cable dia. (IIIII)	Model	Model	willimum order
	8-mm-dia. model (7 to 8 mm dia.)	XS2G-D5S7		
5	7-mm-dia. model (6 to 7 mm dia.)	XS2G-D5S9		
	6-mm-dia. model (5 to 6 mm dia.)	XS2G-D5S1	XS2G-D5S2	
	8-mm-dia. model (7 to 8 mm dia.)	XS2G-D4S7		50
	7-mm-dia. model (6 to 7 mm dia.)	XS2G-D4S9		50
4	6-mm-dia. model (5 to 6 mm dia.)	XS2G-D4S1	XS2G-D4S2	
	4-mm-dia. model (4 to 5 mm dia.)	XS2G-D4S3	XS2G-D4S4	
	3-mm-dia. model (3 to 4 mm dia.)	XS2G-D4S5	XS2G-D4S6	

Note: XS2G Screw-on Plugs cannot be connected to side by side to the CN1 and CN2 connectors of XS2R Y-Joint Sockets/Plugs.


XS2C Screw-on Socket Assemblies

Dimensions (Unit: mm)

XS2C-D5S7 (5-pole, Straight, Applicable Cable Outer Diameter: 8 mm) XS2C-D5S9 (5-pole, Straight, Applicable Cable Outer Diameter: 7 mm) XS2C-D4S7 (4-pole, Straight, Applicable Cable Outer Diameter: 8 mm) XS2C-D4S9 (4-pole, Straight, Applicable Cable Outer Diameter: 7 mm)








XS2C-D5S1 (5-pole, Straight, Applicable Cable Outer Diameter: 6 mm)
XS2C-D4S
(4-pole, Straight, Applicable Cable Outer Diameter: 3, 4, or 6 mm)








XS2C-D5S2 (5-pole, L-shaped, Applicable Cable Outer Diameter: 6 mm)
XS2C-D4S
(4-pole, L-shaped, Applicable Cable Outer Diameter: 3, 4, or 6 mm)





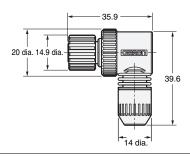

Ordering Information

No. of poles	les Suitable cable dia. (mm) Straight connectors (for DC) L-shaped connectors (for		L-shaped connectors (for DC)	Minimum order
No. of poles	Suitable Cable dia. (IIIII)	Model	Model	willing order
	8-mm-dia. model (7 to 8 mm dia.)	XS2C-D5S7		
5	7-mm-dia. model (6 to 7 mm dia.)	XS2C-D5S9		
	6-mm-dia. model (5 to 6 mm dia.)	XS2C-D5S1	XS2C-D5S2	
	8-mm-dia. model (7 to 8 mm dia.)	XS2C-D4S7		50
	7-mm-dia. model (6 to 7 mm dia.)	XS2C-D4S9		50
4	6-mm-dia. model (5 to 6 mm dia.)	XS2C-D4S1	XS2C-D4S2	
	4-mm-dia. model (4 to 5 mm dia.)	XS2C-D4S3	XS2C-D4S4	
	3-mm-dia. model (3 to 4 mm dia.)	XS2C-D4S5	XS2C-D4S6	

XS2P Panel-mounting Sockets for Terminal Boxes


Dimensions (Unit: mm)

XS2P-□421-2 (with Solder Cup Pins) Rear Lock Model







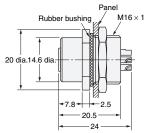




XS2P-U422-1 (with DIP Pins)


XS2P-□422-2 (with Solder Cup Pins)


Front Lock Model








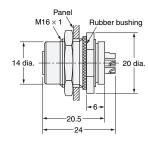

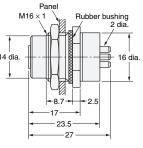




With Solder Cup Pins


With DIP Pins

Panel Cutout



Note: The panel thickness is 1 to 4 mm.

PCB-mounting Dimensions





Ordering Information


Lock method Pin shape		ook method Din chang		Minimum order
Lock method	Fili Silape	Model	Model	Willimum order
Rear lock	Solder cup pin	XS2P-D421-2	XS2P-A421-2	
Front look	Solder cup pin	XS2P-D422-2	XS2P-A422-2	50
Front lock	DIP pin	XS2P-D422-1	XS2P-A422-1	

XS2R Y-Joint Plug/Socket Connectors

Dimensions (Unit: mm)

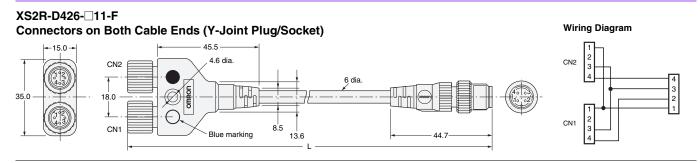

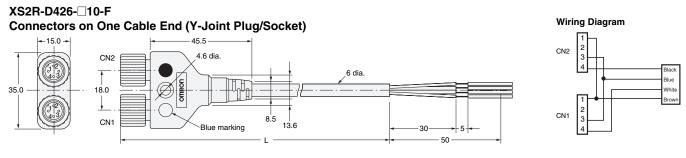

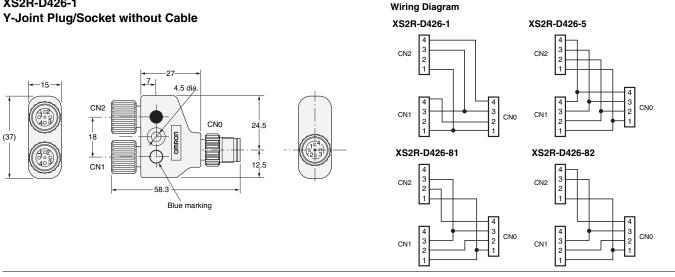

Ordering Information

XS2R-D426-1

Tuno	Connector	DC		
Туре	Connector	Cable length L (m)	Model	Minimum order
		0.5	XS2R-D426-B11-F	
	Connectors on both cable ends	1	XS2R-D426-C11-F	
With cable	Connectors on both cable ends	2	XS2R-D426-D11-F	5
		3	XS2R-D426-E11-F	
	Connector on one coble and	2	XS2R-D426-D10-F	
	Connector on one cable end	5	XS2R-D426-G10-F	
			XS2R-D426-1	
AAPIL I I.I.	V laint plug/apakat		XS2R-D426-5	10
Without cable	Y-Joint plug/socket		XS2R-D426-81	10
			XS2R-D426-82	


Note: XS2G Screw-on Plugs cannot be connected side-by-side to the CN1 and CN2 connectors. Consider using a crimping or soldering model instead. Refer to page 13 for details.


XS2R T-Joint Plug/Socket Connectors


Dimensions (Unit: mm)

XS2R-D422-1 XS2R-D422-5 Aggregate Models



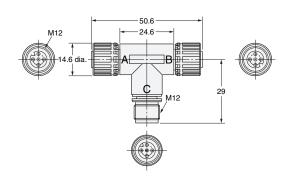


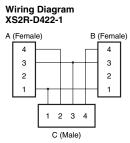


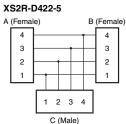

XS2R-D423-1 Bifurcated Model




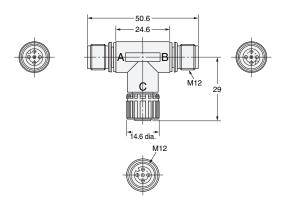


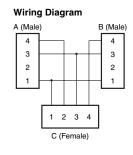

XS2R-D424-1 Daisy-chain Model



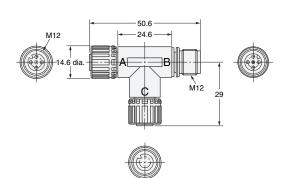

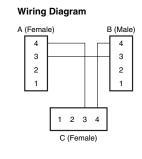


Ordering Information


Type	DC	
Туре	Model	Minimum order
Aggragata model	XS2R-D422-1	
Aggregate model	XS2R-D422-5	20
Bifurcated model	XS2R-D423-1	- 20
Daisy-chain model	XS2R-D424-1	=

XS2R Application Examples


XS2R-D422-1 (Aggregate Model)

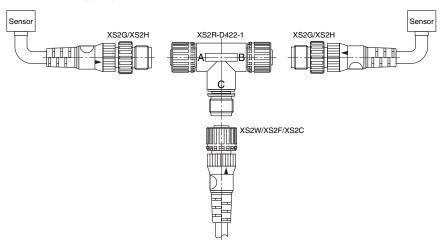


- A pair of Two-wire Sensors or Three-wire Sensors can be connected as shown in the illustration.
- The XS2R-D422-5 has feedthrough connections, thus working as a connector for the extension cable.

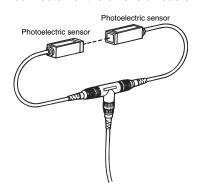


XS2R-D423-1 (Bifurcated Model)

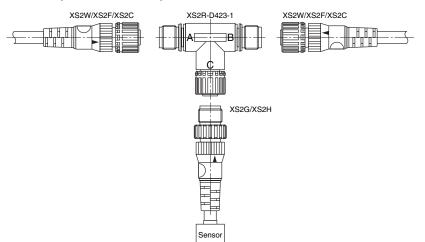

• Two or Three-wire Sensor signals can be bifurcated.

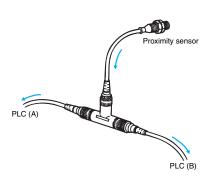

XS2R-D424-1 (Daisy Chain Model)

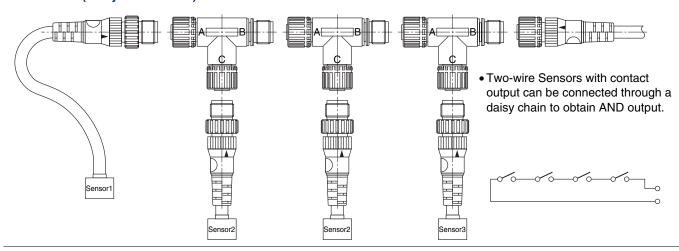

Safety Precautions

Precautions for Correct Use

Do not use this product under ambient conditions that exceed the ratings.

Before using the XS2R for Sensors, make sure that the wiring of the Sensors and the internal connections of the XS2R are correct.


XS2M Sensor-embedded Plugs

Dimensions (Unit: mm)


XS2M-D421 (DC) XS2M-A421 (AC)

(Embedded Plug with Screw Threads)










Note: After mounting, anchor the solder cups by injecting resin.


XS2M-D422 (DC) XS2M-A422 (AC)

(Embedded Plug without Screw Threads)







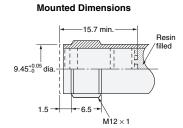

Note: After mounting, anchor the solder cups by injecting resin.


XS2M Panel-mounting Plugs


Dimensions (Unit: mm)


XS2M-D423 (For DC) XS2M-A423 (For AC)


(Flange-mounting Model)



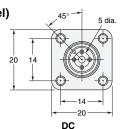



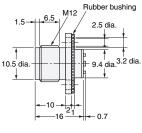

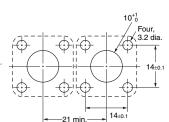

Panel Cutouts


XS2M-□424-1 (With DIP Pins)


XS2M-□424-2 (With Solder Cup Pins)


(Screw-mounting Model)








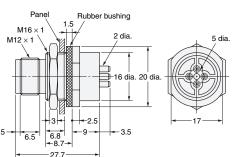



Note: The panel thickness is 1 to 4 mm.

PCB-mounting Dimensions



Ordering Information


Mounting method	Pin shape	DC	AC	Minimum order	
Mounting method	r III siiape	Model	Model		
Embedded with screw threads		XS2M-D421	XS2M-A421		
Embedded with no screw threads	Solder cup pin	XS2M-D422	XS2M-A422		
Flange-mounting		XS2M-D423	XS2M-A423	50	
Screw-mounting	DIP pin	XS2M-D424-1	XS2M-A424-1		
	Solder cup pin	XS2M-D424-2	XS2M-A424-2		

Connector Covers

Water-resistive Covers


XS2Z-11





XS2Z-22






The Water-resistive Cover ensures IP67. When mounting the Water-resistive Cover to a Connector, be sure to apply a torque range between 0.39 and 0.49 N·m to tighten the Water-resistive Cover.

Model	Minimum order	Material	Suitable connector		
IVIOGEI IV			Model	Mounting portion	
XS2Z-11	- 50	Brass/nickel plated	XS2G/XS2H/XS2M/XS2R/XS2W/XS5H/ XS5M/XS5W	M12 male screw	
XS2Z-22			LXS2C/XS2R/XS2F/XS2P/XS2W/XW3R/	M12 female screw (thread bracket)	

Dust Covers

XS2Z-13






XS2Z-15/XS2Z-14








The Dust Cover is for dust prevention and does not ensure IP67 degree of protection. When mounting the Dust Cover to a connector, be sure to press the Dust Cover onto the Connector until the Connector is fully inserted into the Dust Cover.

Model Minimum ord	Minimum arder	r Material	Suitable connector		
	willing or der		Model	Mounting portion	
XS2Z-13		Rubber/black	XS2G/XS2H/XS2M/XS2R	M12 male screw	
XS2Z-14	50			Pin block (female pins)	
XS2Z-15				M12 female screw (thread bracket)	

Sputter Protective Cover

XS2Z-31





The Sputter Protective Cover protects the connector from weld sputter.

Make sure it covers the entire connector.

Model	Material	Applicable connector		
XS2Z-31	Silicone rubber/black	XS2F/XS2H/XS2W		

Tools

Crimp Tool


Locator XY2F-0003





Use the Crimp Tool to crimp a cable core to the XS2U Crimping Pin used with the XS2C or XS2G Crimping Connector.


- The XY2F-0002 Crimp Tool is DMC's AFM8 (M22520/2-
- Mount the XY2F-0003 Locator (sold separately) to the locator guide of the Crimp Tool with a screw provided with the XY2F-0003 Locator.

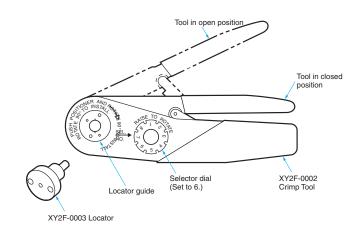

Pin-block Extraction Tool


XY2F-0001

Use this tool to extract a Pin Block from the covers in order to make wiring changes or corrections after the cover has been mounted to the pin block for Connector Assemblies (XS2C/ XS2G, soldering/crimping).




Extraction Procedure


- (1) Disconnecting Components
- Disconnect all components on the cap side from the cover.

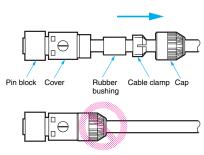


- (2) Extracting Pin Block
- Insert the claws of the Tool into the four holes of the cover.

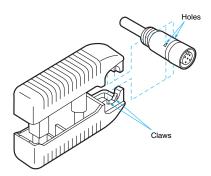

• Make sure that the pin block is outside the Tool.



• Press the Tool so that the guides of the Tool are in close contact. Then pull the pin block straight.



Precaution

• The pin block must not be extracted from the same Connector more than 3 times, otherwise the proper degree of protection of the pin block or Connector will not be maintained.

Assembly Procedure for XS2C/XS2G Connector Assemblies

(1) Connector and Cable External Diameters

- Connectors for 6-, 4-, and 3-mm-diameter Cables (i.e., Cables that are 5 to 6, 4 to 5, and 3 to 4 mm in diameter respectively) are available. When assembling a Connector used with a cable, make sure that the external diameter of the Connector is suited to that of the cable.
- Connectors for 6-mm-diameter Cables use white cable clamps. Connectors for 4- and 3-mm-diameter Cables use black cable clamps.


A watertight bushing for 6-mm-diameter Cable has no stripe, that for 4-mm-diameter Cable has a single stripe, and that for 3-mm-diameter Cable has two stripes.

Note: When connecting a commercially available cable to a connector assembly, use a cable with an outside diameter of 3 to 6 mm and core sizes of 0.18 to 0.75 mm² for crimping connectors and 0.5 mm² maximum for soldering connectors.


(2) Component Insertion

Crimping/Soldering Connectors

Straight Connectors



L-shaped Connectors




*A ring is not required for Screw-on Connectors.

 As shown in the above illustration, connect the above components to the Cable with its end processed.

Screw-on Connectors

Confirm that you have all of the required parts.

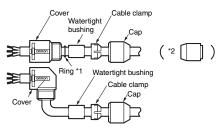


Insulation caps and insulation tubes are included with 5-pole Connectors (XS2C-D5S \square and XS2G-D5S \square).

- *1.Rings are not required with 7-mm and 8-mm cables.
- *2.Insert the waterproof bushing for 7-mm and 8-mm cables in the direction shown in the diagram.

(3) Wiring (Processing Cable Ends)

Soldering Connectors



- Strip 10 mm of the Cable sheath and 4 mm of each core.
- Before soldering cores and solder cup pins together, soldercoat each of them.
- The following conditions are recommended for soldering each solder cup pin.

Soldering iron: 30 to 60 W


Soldering temperature: 280°C to 340°C

Soldering period: 3 s max.

 The length marked *A should be 6.5 mm max., otherwise the proper degree of protection of the connector will not be maintained.

Crimping Connectors


Crimping



- Strip 14 mm of the Cable sheath and 4 mm of each core.
- Make sure that each core is not damaged and its end strands are not spread out.
- Mount the XY2F-0003 Locator to DMC's AFM8 (M25520/2-01) Crimping Tool, both of which are sold separately, and set the selector dial of the Crimping Tool to 6 for the XS2U-□21 and to 7 for the XS2U-□22.
- After mounting the crimping pins to the Locator, fully insert the cores to the crimping pins.
- Squeeze the handle of the Crimp Tool to press-fit the cores to the crimping pins.


(Squeeze the handle firmly until the handle automatically returns to the release position.)

Wiring



 After press-fitting the cores to the pins, insert the pins into the pin clamp as shown in the illustration. Then make sure that the lead colors correspond to the pin clamp numbers that are identical to the connector pin numbers.

Insertion

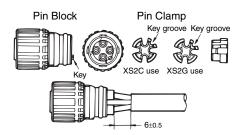


• Tentatively insert the pins to the pin block holes so that the key on the pin block will coincide with the key groove on the pin clamp. Then insert the cable along with the pin clamp.


Screw-on Connectors

Cable End Processing

• Four-pole Connectors




 Loosen the screws on pins 1 to 4 and insert the cores according to the pin numbers.




• Use the special Screwdriver (XW4Z-00B) * and tighten the screws securely so that the cores do not pull out (tightening torque: 0.15 to 0.2 N·m).


• Five-pole Connectors

• Strip the cable sheath for a total of 15 mm and strip the core covering for 8 mm for the core to connect to pin 5.




- Connect the core to pin 5 (in the center) first.
- Insert the core from the side of the hold with the tab and tighten the screw securely (tightening torque: 0.15 to 0.2 N·m), and then cut off the excess wire with wire cutters.






 Bend the cable as shown below, attached the enclosed insulation cap, and then strip the other cores.

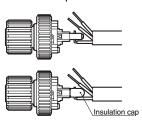

• Connect the cores to pins 1 to 4.

Connecting Shielded Cables to Five-pole Connectors

- Place the insulation tub on the drain line of the shield and connect ti to the terminal.
- Tighten the screw and then check visually to see if there is insulation between the cores.




• Connect the cores to pins 1 to 4.

*When tightening the screws, use the dedicated XW4Z-00B Screwdriver that matches with the screw-slot dimensions.



(4) Inserting Pin Block

Pin Block (Soldering Model) Cover (Straight Model)



(Crimping Model)

(L-shaped Model)





- Mount the cover to the pin block so that the triangle mark on the pin block will coincide with the triangle mark on the cover.
- If the cover is used for an L-shaped model, the relationship between the position of the polarity key on the engaged side and cable connection direction will be determined by the direction in which the positioning key is inserted into the cover, which can be rotated by 90°.
- Fully insert the positioning key until the positioning key is hidden by the casing.


Pin Block (Screw-mounting Connectors) Cover Triangle mark

- Align the triangular marks on the pin block and cover and insert the pin block into the cover.
- Press them together firmly (0.39 to 0.49 N·m) until the pin block does not come out of the cover.

(5) Mounting Cap

 After mounting the cover to the pin block and the cover snaps into place, tighten the cap securely by hand within a torque of 0.39 and 0.49 N·m.

Note: If the cap is not tighten securely enough, the degree of protection (IP67) may not be maintained or vibration may cause the cap to become loose. Do not tighten the cap with pliers or similar tools; they may damage the cap



 After fully tightening the cap, length A should be approximately one of the following according to the cable external diameter and the Connector model.

Connector	Cable external diameter (mm)			
Connector	6 mm	5 mm	4 mm	3 mm
For 6-mm-dia. cable	1	0		
For 4-mm-dia. cable		2	1	
For 3-mm-dia. cable			2	1

(6) After Assembly


 Confirm the insulation between cores after completing assembly.

Recommended Cables

When connecting a commercially available cable to a connector assembly, use a cable with an outside diameter of 3 to 6 mm and core sizes of 0.18 to 0.75 mm² for crimping connectors and 0.5 mm² maximum for soldering connectors.

Connector Arrangement

For safety, when constructing a connection system between a Sensor and panel with a connector, make sure that the connector plug is on the Sensor side and the connector socket is on the panel side (i.e., the female pins are located on the power-supply side).



Safety Precautions

Precautions for Correct Use


Do not use the product in atmospheres or environments that exceed product ratings.

Tightening Cap (Connector Assemblies)

- 1. Do not use pliers to tighten caps, otherwise the caps may be damaged. Be sure to tighten each cap by hand within a torque range between 0.39 and 0.49 N⋅m.
- 2. If caps are not tightened securely, the Connectors may not maintain their proper degree of protection (i.e., IP67) or the caps may become loose due to vibration.

Connector Connection and Disconnection

- When connecting or disconnecting Connectors, be sure to hold the Connectors by hand.
- Do not hold the cable part when disconnecting Connectors.
- Connectors mating with sockets must be fully inserted into the sockets. Tighten the thread bracket carefully so that the threads will not be damaged.
- Fully tighten thread bracket within a torque range between 0.39 and 0.49 N⋅m and be sure that the threads of the opposite parts are hidden by the thread bracket.
- When disconnecting Connectors, be sure to loosen the thread brackets first. Do not loosen the caps.
- Thread brackets must be loosened in the cutout direction.

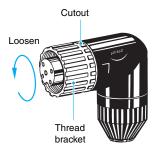

Degree of Protection

- Do not impose external force continuously on the joints of pin blocks and covers, otherwise the Connectors may not keep its proper degree of protection (i.e., IP67).
- The degree of protection of connectors (IP67) is not for a fully watertight structure. Do not use them underwater.
- Connectors are of resin mold construction. Do not impose excessive force on them.

Setup

- Do not make any cable bends near the base of the Unit.
- Any bends made must have a minimum radius of 40 mm.

Read and Understand This Catalog

Please read and understand this catalog before purchasing the products. Please consult your OMRON representative if you have any questions or comments

Warranty and Limitations of Liability

WARRANTY

OMRON's exclusive warranty is that the products are free from defects in materials and workmanship for a period of one year (or other period if specified) from date of sale by OMRON.

OMRON MAKES NO WARRANTY OR REPRESENTATION, EXPRESS OR IMPLIED, REGARDING NON-INFRINGEMENT, MERCHANTABILITY, OR FITNESS FOR PARTICULAR PURPOSE OF THE PRODUCTS. ANY BUYER OR USER ACKNOWLEDGES THAT THE BUYER OR USER ALONE HAS DETERMINED THAT THE PRODUCTS WILL SUITABLY MEET THE REQUIREMENTS OF THEIR INTENDED USE. OMRON DISCLAIMS ALL OTHER WARRANTIES, EXPRESS OR IMPLIED.

LIMITATIONS OF LIABILITY

OMRON SHALL NOT BE RESPONSIBLE FOR SPECIAL, INDIRECT, OR CONSEQUENTIAL DAMAGES, LOSS OF PROFITS OR COMMERCIAL LOSS IN ANY WAY CONNECTED WITH THE PRODUCTS, WHETHER SUCH CLAIM IS BASED ON CONTRACT, WARRANTY, NEGLIGENCE, OR STRICT LIABILITY.

In no event shall the responsibility of OMRON for any act exceed the individual price of the product on which liability is asserted.

IN NO EVENT SHALL OMRON BE RESPONSIBLE FOR WARRANTY, REPAIR, OR OTHER CLAIMS REGARDING THE PRODUCTS UNLESS OMRON'S ANALYSIS CONFIRMS THAT THE PRODUCTS WERE PROPERLY HANDLED, STORED, INSTALLED, AND MAINTAINED AND NOT SUBJECT TO CONTAMINATION, ABUSE, MISUSE, OR INAPPROPRIATE MODIFICATION OR REPAIR.

Application Considerations

SUITABILITY FOR USE

OMRON shall not be responsible for conformity with any standards, codes, or regulations that apply to the combination of products in the customer's application or use of the products.

At the customer's request, OMRON will provide applicable third party certification documents identifying ratings and limitations of use that apply to the products. This information by itself is not sufficient for a complete determination of the suitability of the products in combination with the end product, machine, system, or other application or use.

The following are some examples of applications for which particular attention must be given. This is not intended to be an exhaustive list of all possible uses of the products, nor is it intended to imply that the uses listed may be suitable for the products:

- Outdoor use, uses involving potential chemical contamination or electrical interference, or conditions or uses not described in this catalog.
- Nuclear energy control systems, combustion systems, railroad systems, aviation systems, medical equipment, amusement machines, vehicles, safety equipment, and installations subject to separate industry or government regulations.
- Systems, machines, and equipment that could present a risk to life or property.

Please know and observe all prohibitions of use applicable to the products.

NEVER USE THE PRODUCTS FOR AN APPLICATION INVOLVING SERIOUS RISK TO LIFE OR PROPERTY WITHOUT ENSURING THAT THE SYSTEM AS A WHOLE HAS BEEN DESIGNED TO ADDRESS THE RISKS, AND THAT THE OMRON PRODUCTS ARE PROPERLY RATED AND INSTALLED FOR THE INTENDED USE WITHIN THE OVERALL EQUIPMENT OR SYSTEM.

PROGRAMMABLE PRODUCTS

OMRON shall not be responsible for the user's programming of a programmable product, or any consequence thereof.

Disclaimers

CHANGE IN SPECIFICATIONS

Product specifications and accessories may be changed at any time based on improvements and other reasons.

It is our practice to change model numbers when published ratings or features are changed, or when significant construction changes are made. However, some specifications of the products may be changed without any notice. When in doubt, special model numbers may be assigned to fix or establish key specifications for your application on your request. Please consult with your OMRON representative at any time to confirm actual specifications of purchased products.

DIMENSIONS AND WEIGHTS

Dimensions and weights are nominal and are not to be used for manufacturing purposes, even when tolerances are shown.

PERFORMANCE DATA

Performance data given in this catalog is provided as a guide for the user in determining suitability and does not constitute a warranty. It may represent the result of OMRON's test conditions, and the users must correlate it to actual application requirements. Actual performance is subject to the OMRON Warranty and Limitations of Liability.

ERRORS AND OMISSIONS

The information in this document has been carefully checked and is believed to be accurate; however, no responsibility is assumed for clerical, typographical, or proofreading errors, or omissions.

2012.2

In the interest of product improvement, specifications are subject to change without notice.



Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Omron:

XS2F-A421-D90-A XS2F-A421-G90-A XS2F-A421-GB0-A XS2F-A422-GB0-A XS2F-D421-410 XS2F-D421-C80-A XS2F-D421-C80-F XS2F-D421-D80-A XS2F-D421-D80-R XS2F-D421-DA0-A XS2F-D421-DA0-R XS2F-DA0-R XS2F-DA0-DC0-A XS2F-D421-DC0-TR XS2F-D421-DD0 XS2F-D421-E80-A XS2F-D421-E80-R XS2F-D421-G80-F XS2F-D421-G80-R XS2F-D421-G80-SA XS2F-D421-GA0-A XS2F-D421-GA0-R XS2F-D421-GC0-A XS2F-D421-GD0 XS2F-D421-GD0-TR XS2F-D421-H80-A XS2F-D421-J80-A XS2F-D421-J80-F XS2F-D421-J80-SA XS2F-D421-JC0-A XS2F-D421-K80-A XS2F-D421-S004 XS2F-D421-S005 XS2F-D421-S006 XS2F-D421-S010 XS2F-D421-S011 XS2F-D421-S013 XS2F-D421-S015 XS2F-D421-S017 XS2F-D421-S023 XS2F-D421-S025 XS2F-D421-S026 XS2F-D421-S064 XS2F-D421-T03 XS2F-D421-T80-A XS2F-D422-410 XS2F-D422-D80-R XS2F-D422-DA0-A XS2F-D422-DC0-A XS2F-D422-DC0-TR XS2F-D422-DD0-TR XS2F-D422-G80-R XS2F-D422-GA0-A XS2F-D422-GA0-R XS2F-D422-GC0-A XS2F-D422-GC0-TR XS2F-D422-S027 XS2F-D422-S028 XS2F-D521-DG0-A XS2F-D521-GG0-A XS2F-D821-BH0-C XS2H-D421-A80-A XS2H-D421-AC0-A XS2H-D421-B80-A XS2H-D421-C80-A XS2H-D421-D80-A XS2H-D421-G80-A XS2H-D421-J80-A XS2F-D421-E80-F XS2F-D421-H80-F XS2F-D422-JC0-A XS2F-D821-GH0-C XS2F-D421-G80-A XS2F-D821-DH0-C XS2F-E421-D80-E XS2F-E422-G80-F XS2F-E422-J80-E XS2F-D421-JA0-A XS2F-D421-D80-AZZ XS2F-D422-C80-A XS2F-D422-D80-A XS2F-D422-E80-A XS2F-D422-G80-A XS2F-D422-J80-A XS2H-D422-C80-A XS2H-D422-D80-A XS2H-D422-E80-A XS2F-D421-J80-R XS2F-D421-K80-F XS2F-D421-S077 XS2F-D422-DA0-R XS2F-D821-JH0-C XS2F-M12PVC3A10MLED XS2F-M12PVC3A2MLED XS2F-M12PVC3A5MLED XS2F-M12PVC4A10MLED XS2F-M12PVC4A2MLED XS2F-M12PVC4A5MLED XS2F-D421-KC0-A XS2F-A421-C90-A XS2F-A421-DB0-A



Компания «ЭлектроПласт» предлагает заключение долгосрочных отношений при поставках импортных электронных компонентов на взаимовыгодных условиях!

Наши преимущества:

- Оперативные поставки широкого спектра электронных компонентов отечественного и импортного производства напрямую от производителей и с крупнейших мировых складов:
- Поставка более 17-ти миллионов наименований электронных компонентов;
- Поставка сложных, дефицитных, либо снятых с производства позиций;
- Оперативные сроки поставки под заказ (от 5 рабочих дней);
- Экспресс доставка в любую точку России;
- Техническая поддержка проекта, помощь в подборе аналогов, поставка прототипов;
- Система менеджмента качества сертифицирована по Международному стандарту ISO 9001:
- Лицензия ФСБ на осуществление работ с использованием сведений, составляющих государственную тайну;
- Поставка специализированных компонентов (Xilinx, Altera, Analog Devices, Intersil, Interpoint, Microsemi, Aeroflex, Peregrine, Syfer, Eurofarad, Texas Instrument, Miteq, Cobham, E2V, MA-COM, Hittite, Mini-Circuits, General Dynamics и др.);

Помимо этого, одним из направлений компании «ЭлектроПласт» является направление «Источники питания». Мы предлагаем Вам помощь Конструкторского отдела:

- Подбор оптимального решения, техническое обоснование при выборе компонента;
- Подбор аналогов;
- Консультации по применению компонента;
- Поставка образцов и прототипов;
- Техническая поддержка проекта;
- Защита от снятия компонента с производства.



Как с нами связаться

Телефон: 8 (812) 309 58 32 (многоканальный)

Факс: 8 (812) 320-02-42

Электронная почта: org@eplast1.ru

Адрес: 198099, г. Санкт-Петербург, ул. Калинина,

дом 2, корпус 4, литера А.