

Motion Control Capabilities with Unit Synchronization and Even Higher Speed

- Models are available with 2 or 4 axes and open-collector or line-driver outputs.

The CJ1W-NC214/NC414 have open-collector outputs and the CJ1W-NC234/NC434 have line-driver outputs.

- Control 2 or 4 Axes

High-speed, high-resolution position control is possible for servomotors and pulse motors, and even linear motors and direct drive motors.



CJ1W-NC234



CJ1W-NC434

Features

Improve Productivity with High-speed Control

- A faster pulse output startup time has been achieved. Pulse output will start as fast as 0.1 ms from when the CPU Unit sends the command. (Previous models started pulse output in 2 ms. Refer to the *Operation Manual* for conditions and other details.)
- Pulse output is possible at up to 4 Mpps for compatibility with linear motors and direct drive motors. This achieves both high resolution and high speed.

Increased Added Value with More Advanced Features


- Operation between the CPU Unit and the Position Control Unit can be synchronized using a high-speed bus. Synchronized control is possible between up to five Units, or 20 axes. A wide range of applications can be achieved by also using the electronic cam function.
- Built-in high-speed counters enable monitoring the present values of the motors while controlling positions, all with just a Position Control Unit. The absolute encoders of G-series and G5-series Servomotors are supported, enabling an absolute positioning system.* This eliminates the need to redefine the origin after power interruptions, helping to provide extra added value.
- Select from direct operation or memory operation. Up to 500 positioning sequences can be saved as the data for memory operation for each axis. Any of three end patterns, independent, automatic, or consecutive, can be set for each sequence, and repeat instructions and jump instructions can be used to achieve complex motion control.
- Linear interpolation, circular interpolation, index table control, feeder control, and an MPG function can be used to achieve the functionality of a Motion Control Unit with these Position Control Units.
- A wide range of functions enables easily achieving position control, including teaching, overrides, backlash compensation, zone settings, and S-curve acceleration/deceleration.

Reduce TCO

- All Support Software functions have been integrated into the CX-Programmer. In combination with data tracing and other CX-Programmer functions, work efficiency is improved from design and debugging to system implementation and maintenance.
- The Position Control Units with line-driver outputs generate the 5-VDC power for the line driver internally. Control is possible by providing only a 24-VDC power supply, in the same way as for Units with open-collector outputs.
- A function block library is being prepared that provides function blocks for all Position Control Unit functions. This will reduce ladder programming work. Even sync applications that use an electronic cam will be easy to construct with the function block library.

* You cannot use an absolute encoder if you use a reduction gear.

System Configuration

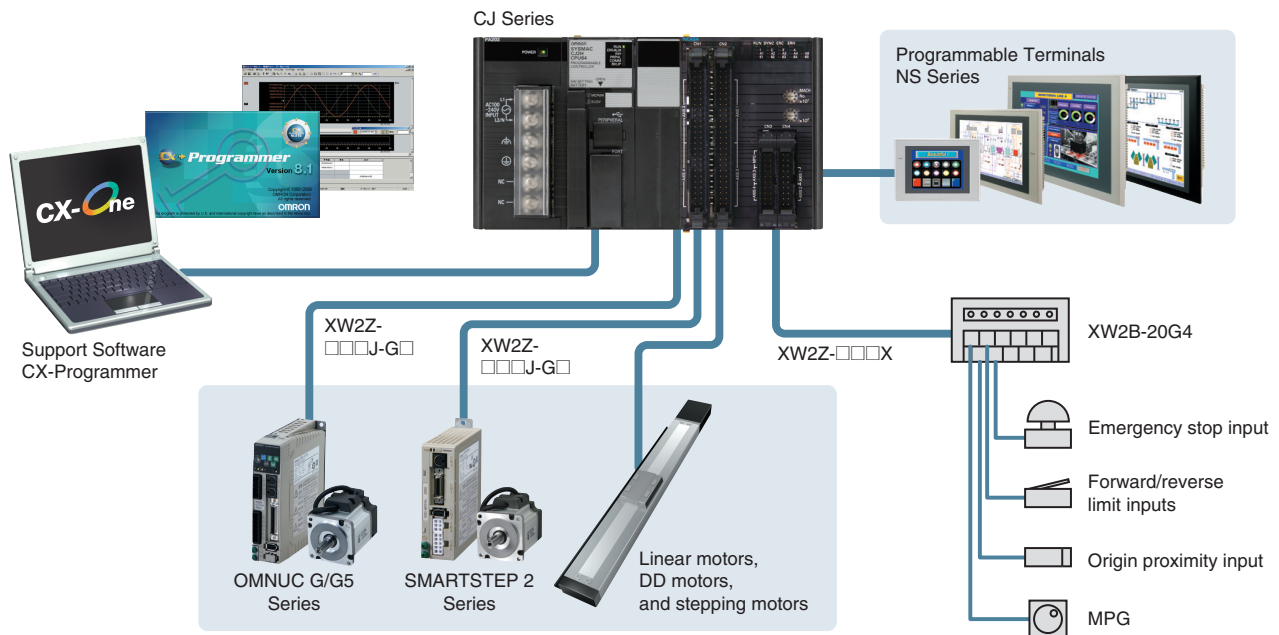

Ordering Information

International Standards

- The standards are abbreviated as follows: U: UL, U1: UL (Class I Division 2 Products for Hazardous Locations), C: CSA, UC: cULus, UC1: cULus (Class I Division 2 Products for Hazardous Locations), CU: cUL, N: NK, L: Lloyd, and CE: EC Directives.
- Contact your OMRON representative for further details and applicable conditions for these standards.

Position Control Units

Unit type	Name	Specifications		No. of unit numbers allocated	Current consumption (A)		Model	Standards
		Control method/Control output interface	Number of control axes		5 V system	24 V system		
CJ1 Special I/O Units	Position Control Units (High-Speed type)	Pulse-train open-collector output with Pulse Counter Function	2 axes	2	0.27	–	CJ1W-NC214	UC1, CE
			4 axes		0.31	–	CJ1W-NC414	
		Pulse-train line-driver output with Pulse Counter Function	2 axes	2	0.27	–	CJ1W-NC234	
			4 axes		0.31	–	CJ1W-NC434	

Note: This unit cannot be used with the Machine Automation Controller NJ-series.

Support Software

Product name	Specifications			Model	Standards
		Number of licenses	Media		
FA Integrated Tool Package CX-One Ver.4.□	<p>The CX-One is a comprehensive software package that integrates Support Software for OMRON PLCs and components. CX-One runs on the following OS.</p> <p>OS: Windows XP (Service Pack 3 or higher, 32-bit version) / Windows Vista (32-bit/64-bit version) / Windows 7 (32-bit/64-bit version) / Windows 8 (32-bit/64-bit version) / Windows 8.1 (32-bit/64-bit version) / Windows 10 (32-bit/64-bit version)</p> <p>CX-One Ver.4.□ includes CX-Programmer Ver.9.□.</p> <p>For details, refer to the CX-One catalog (Cat. No. R134).</p>	1 license *	DVD	CXONE-AL01D-V4	–

* Multi licenses (3, 10, 30, or 50 licenses) and DVD media without licenses are also available for the CX-One.

Connecting Cables

Applicable Units		Applicable Servo Drive		Number of control axes	Cable Length	Model
Output Type	Model	Name	Model			
Open-collector output	CJ1W-NC□14	OMNUC G/G5 Series	R88D-GT/-KT	1 axis	1m	XW2Z-100J-G13
					3m	XW2Z-300J-G13
		SMARTSTEP2	R7D-BP		1m	XW2Z-100J-G16
					3m	XW2Z-300J-G16
		OMNUC G/G5 Series	R88D-GT/-KT	2 axes	1m	XW2Z-100J-G5
					3m	XW2Z-300J-G5
		SMARTSTEP2	R7D-BP		1m	XW2Z-100J-G8
					3m	XW2Z-300J-G8
Line-driver output	CJ1W-NC□34	OMNUC G/G5 Series	R88D-GT/-KT	1 axis	1m	XW2Z-100J-G9
					5m	XW2Z-500J-G9
					10m	XW2Z-10MJ-G9
		SMARTSTEP2	R7D-BP		1m	XW2Z-100J-G12
					5m	XW2Z-500J-G12
					10m	XW2Z-10MJ-G12
		OMNUC G/G5 Series	R88D-GT/-KT	2 axes	1m	XW2Z-100J-G1
					5m	XW2Z-500J-G1
					10m	XW2Z-10MJ-G1
		SMARTSTEP2	R7D-BP		1m	XW2Z-100J-G4
					5m	XW2Z-500J-G4
					10m	XW2Z-10MJ-G4

Devices for External Signal Connection

Devices for External Signal Connection

Name	Specifications	Model
Connecting Cables for Connector Terminal Block	Cable length: 0.5m	XW2Z-C50X
	Cable length: 1.0m	XW2Z-100X
	Cable length: 2.0m	XW2Z-200X
	Cable length: 3.0m	XW2Z-300X
	Cable length: 5.0m	XW2Z-500X
	Cable length: 10.0m	XW2Z-010X
Connector Terminal Block	20-points, M2.4 screw terminal	XW2B-20G4
	20-points, M3.5 screw terminal	XW2B-20G5
	20-points, M3 screw terminal	XW2D-20G6

Servo Drive Connector

Name	Specifications	Model
Connector Socket	For a 50-pin MIL plug-crimp socket connector For AWG24	XG5M-5032-N
Connector Cover	For a 50-pin MIL plug-crimp socket connector	XG5S-5022

Cables with Crimp Terminals (20 Poles)


Cable Length	Model
1.0m	XW2Z-100F
1.5m	XW2Z-150F
2.0m	XW2Z-200F
3.0m	XW2Z-300F
5.0m	XW2Z-500F
10.0m	XW2Z-010F
15.0m	XW2Z-15MF
20.0m	XW2Z-20MF

Accessories

MIL Connectors are not included. Use one of the applicable connector or a dedicated cable with connectors listed above.

Model of PCUs

You can identify the number of axes and output pattern from the model number.

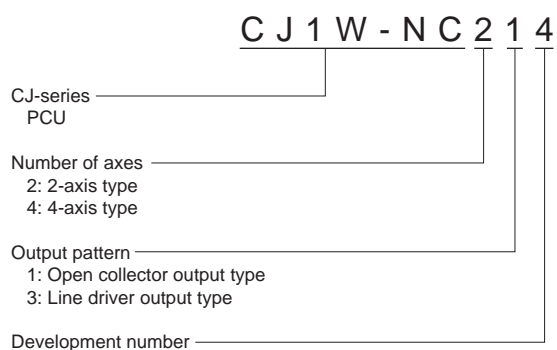

Mountable Racks

Model	NJ system		CJ system (CJ1, CJ2)		CP1H system	NSJ system	
	CPU Rack	Expansion Rack	CPU Rack	Expansion Backplane	CP1H PLC	NSJ Controller	Expansion Backplane
CJ1W-NC214/234/414/434	Not supported		5 Units	5 Units (per Expansion Backplane)	Not Supported	Not Supported	5 Units

Note: With this PCU counts 1 PCU as 2 Component Units.

Accordingly, design an appropriate configuration that meets the formula below:

Number of this PCUs installed × 2 + Number of other PCUs installed ≤ 10

For example, if you install 5 PCUs in 1 rack, you cannot install other PCUs.

Unit Versions and Programming Devices

The following tables show the relationship between unit versions and CX-Programmer versions.

CPU Unit	Functions	Required Programming Device			
		CX-Programmer			Programming Console *
		Ver. 7.1 or lower	Ver. 8.0	Ver. 8.02 or higher	
CJ1W-NC□□4 Unit Ver.1.0	Functions for unit version 1.0	Not supported	Not supported	Supported	Not supported

* Programming Console cannot be used for CJ1W-NC□□4

Function List of Function Block Library (FBL)

Functional Function Block Library (FBL)

1	Move Absolute	14	Manual Pulses Output
2	Unlimited Move Absolute	15	Read Status
3	Move Relative	16	Read Parameter
4	Speed Control	17	Read Error
5	Origin Search	18	Read Present Position
6	Origin Return	19	Present Position Latch
7	Deceleration Stop	20	Write Parameter
8	Operation Command	21	Save Parameter
9	Error Reset	22	Teaching
10	Deviation Counter Reset	23	Present Position Preset
11	Run Program	24	Override Setting
12	Interrupt Feeding	25	Torque Limits
13	Jogging / Inching	26	Absolute Encoder's Origin Position Offset Setting

Application Function Block Library (FBL)

1	Electronic Cam	4	Trailing Synchronization
2	Electronic Shaft	5	Link Operation
3	Virtual Pulse		

Specifications

General Specifications

Specification item	Model	
	CJ1W-NC214/234	CJ1W-NC414/434
Power supply voltage	5 VDC (unit) 24 VDC (external power supply)	
Allowable power supply voltage range	21.6 to 26.4 VDC (external power supply)	
Internal current consumption	5 VDC, 270 mA maximum	5 VDC, 310 mA maximum
Current consumption of external power supply	24 VDC NC214 13 mA maximum NC234 44 mA maximum	24 VDC NC414 26 mA maximum NC434 90 mA maximum
Dimensions	90 × 51 × 65 (H × W × D)	90 × 62 × 65 (H × W × D)
Weight	170 g maximum	220 g maximum
Ambient operating temperature	0 to 55°C	
Mounting position	CJ-series CPU Rack or CJ-series Expansion Rack	
Maximum number of units per rack	5 units	
Maximum number of units per CJ system	20 units (when up to 3 expansion racks are connected)	
Occupied unit	No. 2	
Applicable standards	cULus, EC directives	

Models other than above conform to the general specifications of the CJ series.

Performance Specifications

Specification item		Model	
		CJ1W-NC214/234	CJ1W-NC414/434
Applicable PLCs		CJ-series	
Number of occupied inputs/outputs	Number of words	18CH *	
Controlled drivers		Servo Drive of pulse train input type or stepping motor drivers NC214/414: Open collector output type NC234/434: Line driver output type	
Pulse output method		Phase difference pulse output, forward/reverse direction pulse output, pulse + direction output	
Controls	Control method	Open-loop control by pulse train output	
	Number of controlled axes	2 axes	4 axes
Units of control		Pulse, mm, inch, degree	
Positioning functions		Memory operation, direct operation	
	Independent operation	Independent, 2 axes	Independent, 4 axes
	Linear interpolation	2 axes maximum	4 axes maximum
	Circular interpolation	2 axes maximum	2 axes maximum
	Speed control	Independent, 2 axes	Independent, 4 axes
	Interrupt Constant-pitch Feed	Independent, 2 axes	Independent, 4 axes
Position command	Data	-2147483648 to +2147483647	
	Number of data	500 per task (4 tasks per unit)	
Speed command	Data	Position control: 1 to 2147483647 Speed control: -2147483648 to 2147483647 However, this limits the maximum output frequency based on whether the maximum speed is 4 Mpps (NC234/434) or 500 kpps (NC214/414).	
	Number of data	500 per task	
Acceleration/deceleration time	Data	0 to 250000 ms	
	Number of data	500 per task	
Function	Override	0.01% to 500.00% (settable for each axis)	
	Software limits	-2147483647 to 2147483646 command unit (Settable for each axis)	
	Backlash Compensation	0 to 50000 command unit (settable for each axis)	
MPG and external encoder counter input	Number of input words	1 word (switchable for each controlled axis)	
	Input interface	Photocoupler input	
	Maximum response frequency	500 kHz	
Feedback pulse counter input	Number of input words	4 words (1 word per axis)	
	Input interface	Line receiver input	
	Maximum response frequency	NC234/434: 4 MHz (phase difference multiplication of 4 times: 1 MHz) NC214/414: 500 kHz (phase difference multiplication of 4 times: 125 kHz)	


* This indicates the number of occupied words of special I/O Unit area. In addition, this occupies areas that correspond to up to 144 words according to the number of axes and functions which you use.

Functional Specifications

Function item			Description
Control function	Single axis control	Absolute movement	Specify the absolute/relative target position and target speed directly in the ladder program to perform positioning.
		Relative movement	
		Speed control	Specify the target speed directly in the ladder program to perform speed feed.
		Interrupt Feeding	Externally issue an interrupt input during absolute movement, relative movement or speed control to feed the machine by a constant amount to perform positioning.
		Rotational axis control	Rotational axes suitable for feeder and index table control are supported. In addition to forward/reverse direction positioning, you can also specify short-cut operation.
		Target position and target speed change	Change the target position or target speed during absolute movement, relative movement or speed control.
	Multi-axis control	Linear interpolation	This control starts/ends the operations of multiple axes simultaneously and connects the start position to target position of each axis by a straight line. Linear interpolation of up to 4 axes is possible.
		Circular interpolation	You can combine 2 desired axes and control each axis in a manner which the axes draw a circular path. Three methods are available to specify a circular arc: "Specification of target position and center point", "specification of target position, radius and direction" and "target position and passing points".
	Memory operation	Automatic operation and continuous operation	Set the target positions, target speeds and operation patterns in the PCU beforehand to perform a series of operations automatically. Continuous positioning and speed changes are also possible.
		Sequence function	Memory operation data incorporates a sequence feature that allows for repetition of a given operation, start/end of operation data via external inputs, and so on. Accordingly, the PCU can perform various operation sequences without affecting the ladder program of PLC.
Manual operation function	Origin Search		This function uses an external sensor, etc. to detect the mechanical origin of the system. You can select a desired origin search operation for your system from 15 different origin search operation patterns.
	Origin Return		This function performs the return operation to the established mechanical origin.
	Present Position Present		It changes the present position to the specified data and establishes the origin.
	Deceleration stop		The operating axis decelerates to a stop.
	JOG Operation		This function feeds the axis in the forward/reverse direction at a constant speed.
	Inching operation		The axis inches in the forward/reverse direction.
	MPG operation		Connect a manual pulsar and perform manual feed.
Auxiliary control function	Command unit setting		You can set a desired unit of control for each axis according to the machine.
	Acceleration/deceleration control	Auto acceleration/deceleration control	This function automatically generates an acceleration/deceleration curve for axis operation. You can select the trapezoidal curve or the S-curve based on a tertiary function.
		Acceleration/deceleration time change	You can change the acceleration/deceleration time during acceleration/deceleration.
		Acceleration/deceleration point switch	You can select one of three methods to connect speeds in different operation patterns during continuous-pattern memory operation.
	Override		This function changes the speed of the axis which is currently in positioning operation.
	Backlash Compensation		This compensates for the mechanical plays to increase the positioning accuracy.
	M code		You can output M codes to implement interlocking with external machines during memory operation.
	Zone setting		You can set a desired zone and assess whether the present position is inside the zone. Up to 3 zones are settable for each axis.
	Feedback pulse counter		A feedback pulse counter input is available for each axis. You can connect encoder pulse outputs from a Servo Drive to monitor deviation from the command position, etc.
	Absolute encoder		You can input encoder pulses from a Servo Drive to a feedback pulse counter to use a motor with absolute encoder. This function supports OMRON G-series and G5-series Servomotors with absolute encoder.
	Teaching		This function enables loading of the present position into memory operation position data. It supports not only the present command position, but also the present position from the feedback pulse counter.
	Torque limit output		An output signal is available for operating the torque limit switch input of a Servo Drive. You can turn this output signal ON/OFF directly in the ladder program. Also, Origin Search by holding supports automatic switching of torque limits.
	Monitor function	Software limits	You can set forward/reverse direction software limits of axis operation. If the positioning target exceeds software limit, it is detectable at the start through a command value check.
		Position or speed error monitor	The PCU can monitor the position or speed error between the present command position and present feedback position to generate an error and stop the axis operation upon detection of an excessive error.
		Error between axes monitor	It can also monitor the error between axes during linear interpolation to generate an error and stop the axes operation upon detection of an excessive error.

External Interface

Name of Each Part

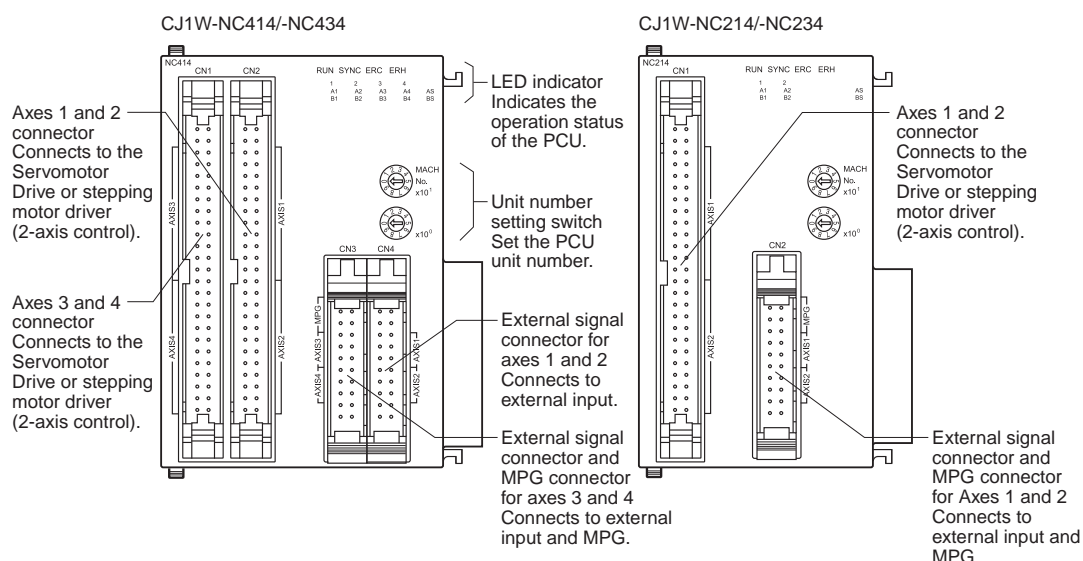

LED Display

LED name	Display color	Status	Explanation	
RUN	Green	Lit	Normal operation	
		Unlit	The power supply is OFF, a hardware error has occurred, or the PLC detects a PCU error.	
ERC	Red	Lit	An error is occurring.	
		Unlit	Other than the above	
ERH	Red	Lit	An error is occurring in the PLC.	
		Unlit	Other than the above	
1	Orange	Lit	Pulse output to Axis 1 in progress (forward/reverse direction)	
		Flashing	An error related to a connection cable, data, etc. of axis 1 has occurred.	
		Unlit	Other than the above	
2	Orange	Lit	Pulse output to Axis 2 in progress (forward/reverse direction)	
		Flashing	An error related to a connection cable, data, etc. of axis 2 has occurred.	
		Unlit	Other than the above	
3	Orange	Lit	Pulse output to Axis 3 in progress (forward/reverse direction)	
		Flashing	An error related to a connection cable, data, etc. of axis 3 has occurred.	
		Unlit	Other than the above	
4	Orange	Lit	Pulse output to Axis 4 in progress (forward/reverse direction)	
		Flashing	An error related to a connection cable, data, etc. of axis 4 has occurred.	
		Unlit	Other than the above	
A1, B1	Orange	Lit	ON	Phase A/B-input status of the Axis 1 feedback counter
		Unlit	OFF	ON when lit, OFF when unlit
A2, B2	Orange	Lit	ON	Phase A/B-input status of the Axis 2 feedback counter
		Unlit	OFF	ON when lit, OFF when unlit
A3, B3	Orange	Lit	ON	Phase A/B-input status of the Axis 3 feedback counter
		Unlit	OFF	ON when lit, OFF when unlit
A4, B4	Orange	Lit	ON	Phase A/B-input status of the Axis 4 feedback counter
		Unlit	OFF	ON when lit, OFF when unlit
AS, BS	Orange	Lit	ON	Phase A/B-input status of the MPG input
		Unlit	OFF	ON when lit, OFF when unlit
SYNC	Green	Lit	In the SYNCHRONOUS OPERATION mode	
		Unlit	Other than the above	

Wiring of Servo Drive Connector


Connector type		Model
Flat-cable connector		XG4M-5030-T *1
IDC connector for discrete wires	Socket	XG5M-5032-N *2
		XG5M-5035-N *3
	Hood cover	XG5S-5022 (horizontal)

*1. This connector comes with a strain relief. To connect to the PCU, use a connector with strain relief.

*2. The applicable wire is AWG24 (UL-1061).

*3. The applicable wire is AWG28 to 26 (UL-1007).

Configuration Diagram for IDC Connector for Discrete Wires

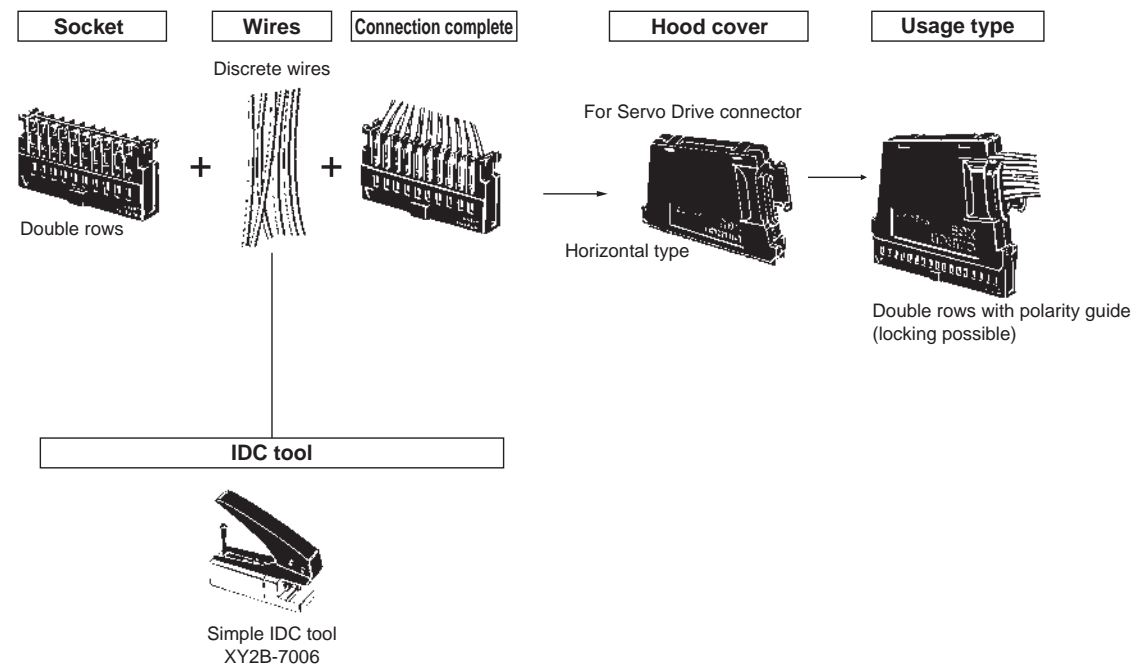


Dimensions

(Unit: mm)

Position Control Unit (High-Speed type)


CJ1W-NC214/-NC234

(2-axis control)

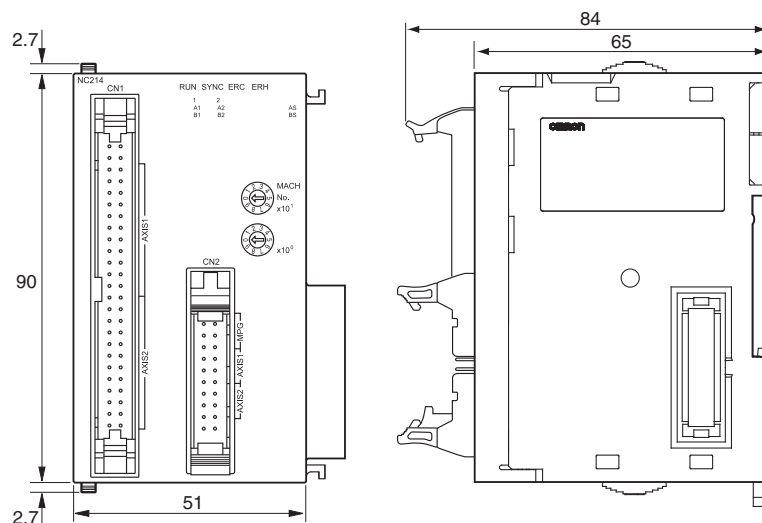

CJ1W-NC414/-NC434

(4-axis control)

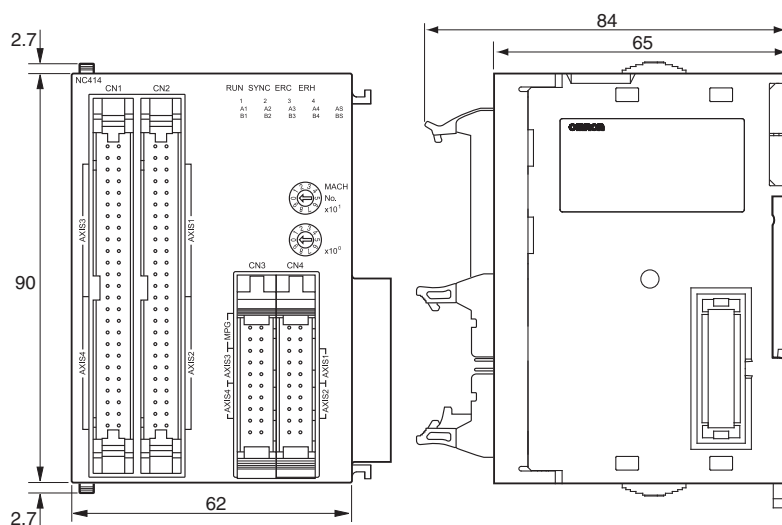

Related Manuals

Manual Number		Model	Name	Contents
English	Japanese			
W477	SBCE-354	CJ1W-NC214/234/414/434	Position Control Units Operation Manual	Provides information on operating and installing Position Control Units, including details, on basic settings, memory operation, direct operation from CPU and other functions.
W446	SBCA-337	CXONE-AL□□D-V□	CX-Programmer Operation Manual	Describes operating procedures for the CX-Programmer. Also refer to the <i>Software User's Manual</i> (W473) and <i>Instructions Reference Manual</i> (W474) when you do programming.

Terms and Conditions Agreement

Read and understand this catalog.

Please read and understand this catalog before purchasing the products. Please consult your OMRON representative if you have any questions or comments.

Warranties.

(a) Exclusive Warranty. Omron's exclusive warranty is that the Products will be free from defects in materials and workmanship for a period of twelve months from the date of sale by Omron (or such other period expressed in writing by Omron). Omron disclaims all other warranties, express or implied.

(b) Limitations. OMRON MAKES NO WARRANTY OR REPRESENTATION, EXPRESS OR IMPLIED, ABOUT NON-INFRINGEMENT, MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE OF THE PRODUCTS. BUYER ACKNOWLEDGES THAT IT ALONE HAS DETERMINED THAT THE PRODUCTS WILL SUITABLY MEET THE REQUIREMENTS OF THEIR INTENDED USE.

Omron further disclaims all warranties and responsibility of any type for claims or expenses based on infringement by the Products or otherwise of any intellectual property right. (c) Buyer Remedy. Omron's sole obligation hereunder shall be, at Omron's election, to (i) replace (in the form originally shipped with Buyer responsible for labor charges for removal or replacement thereof) the non-complying Product, (ii) repair the non-complying Product, or (iii) repay or credit Buyer an amount equal to the purchase price of the non-complying Product; provided that in no event shall Omron be responsible for warranty, repair, indemnity or any other claims or expenses regarding the Products unless Omron's analysis confirms that the Products were properly handled, stored, installed and maintained and not subject to contamination, abuse, misuse or inappropriate modification. Return of any Products by Buyer must be approved in writing by Omron before shipment. Omron Companies shall not be liable for the suitability or unsuitability or the results from the use of Products in combination with any electrical or electronic components, circuits, system assemblies or any other materials or substances or environments. Any advice, recommendations or information given orally or in writing, are not to be construed as an amendment or addition to the above warranty.

See <http://www.omron.com/global/> or contact your Omron representative for published information.

Limitation on Liability; Etc.

OMRON COMPANIES SHALL NOT BE LIABLE FOR SPECIAL, INDIRECT, INCIDENTAL, OR CONSEQUENTIAL DAMAGES, LOSS OF PROFITS OR PRODUCTION OR COMMERCIAL LOSS IN ANY WAY CONNECTED WITH THE PRODUCTS, WHETHER SUCH CLAIM IS BASED IN CONTRACT, WARRANTY, NEGLIGENCE OR STRICT LIABILITY.

Further, in no event shall liability of Omron Companies exceed the individual price of the Product on which liability is asserted.

Suitability of Use.

Omron Companies shall not be responsible for conformity with any standards, codes or regulations which apply to the combination of the Product in the Buyer's application or use of the Product. At Buyer's request, Omron will provide applicable third party certification documents identifying ratings and limitations of use which apply to the Product. This information by itself is not sufficient for a complete determination of the suitability of the Product in combination with the end product, machine, system, or other application or use. Buyer shall be solely responsible for determining appropriateness of the particular Product with respect to Buyer's application, product or system. Buyer shall take application responsibility in all cases.

NEVER USE THE PRODUCT FOR AN APPLICATION INVOLVING SERIOUS RISK TO LIFE OR PROPERTY OR IN LARGE QUANTITIES WITHOUT ENSURING THAT THE SYSTEM AS A WHOLE HAS BEEN DESIGNED TO ADDRESS THE RISKS, AND THAT THE OMRON PRODUCT(S) IS PROPERLY RATED AND INSTALLED FOR THE INTENDED USE WITHIN THE OVERALL EQUIPMENT OR SYSTEM.

Programmable Products.

Omron Companies shall not be responsible for the user's programming of a programmable Product, or any consequence thereof.

Performance Data.

Data presented in Omron Company websites, catalogs and other materials is provided as a guide for the user in determining suitability and does not constitute a warranty. It may represent the result of Omron's test conditions, and the user must correlate it to actual application requirements. Actual performance is subject to the Omron's Warranty and Limitations of Liability.

Change in Specifications.

Product specifications and accessories may be changed at any time based on improvements and other reasons. It is our practice to change part numbers when published ratings or features are changed, or when significant construction changes are made. However, some specifications of the Product may be changed without any notice. When in doubt, special part numbers may be assigned to fix or establish key specifications for your application. Please consult with your Omron's representative at any time to confirm actual specifications of purchased Product.

Errors and Omissions.

Information presented by Omron Companies has been checked and is believed to be accurate; however, no responsibility is assumed for clerical, typographical or proofreading errors or omissions.

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Omron:

[CJ1W-NC414](#) [CJ1W-NC214](#) [XW2Z-200X](#) [CJ1W-NC434](#) [CJ1W-NC234](#)



Компания «ЭлектроПласт» предлагает заключение долгосрочных отношений при поставках импортных электронных компонентов на взаимовыгодных условиях!

Наши преимущества:

- Оперативные поставки широкого спектра электронных компонентов отечественного и импортного производства напрямую от производителей и с крупнейших мировых складов;
- Поставка более 17-ти миллионов наименований электронных компонентов;
- Поставка сложных, дефицитных, либо снятых с производства позиций;
- Оперативные сроки поставки под заказ (от 5 рабочих дней);
- Экспресс доставка в любую точку России;
- Техническая поддержка проекта, помощь в подборе аналогов, поставка прототипов;
- Система менеджмента качества сертифицирована по Международному стандарту ISO 9001;
- Лицензия ФСБ на осуществление работ с использованием сведений, составляющих государственную тайну;
- Поставка специализированных компонентов (Xilinx, Altera, Analog Devices, Intersil, Interpoint, Microsemi, Aeroflex, Peregrine, Syfer, Eurofarad, Texas Instrument, Miteq, Cobham, E2V, MA-COM, Hittite, Mini-Circuits, General Dynamics и др.);

Помимо этого, одним из направлений компании «ЭлектроПласт» является направление «Источники питания». Мы предлагаем Вам помощь Конструкторского отдела:

- Подбор оптимального решения, техническое обоснование при выборе компонента;
- Подбор аналогов;
- Консультации по применению компонента;
- Поставка образцов и прототипов;
- Техническая поддержка проекта;
- Защита от снятия компонента с производства.



Как с нами связаться

Телефон: 8 (812) 309 58 32 (многоканальный)

Факс: 8 (812) 320-02-42

Электронная почта: org@eplast1.ru

Адрес: 198099, г. Санкт-Петербург, ул. Калинина, дом 2, корпус 4, литера А.